



RENAULT ESPACE: 1PDZ322

Vinnumber:	VF1RFC00055950746	Versionname:	1.6 DCI 130 ENERGY INTENS
First Registrationdate:	14/06/2016	Fiscalpower:	
Expertise Mileage:	115074	Power Kw:	96
Bodytype:	MPV	Body color:	Silver
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3620
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

GPS storage		Central consol F	
GPS storage	HD	Luggage cover	
Windows electric F		Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control		Type of Tow bar	No Tow bar
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting LED		
Type of GPS	GPS big screen color		
Type of Lining	Lining semi-artificial leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

235/60/18/103 V LightMetal				
Summer tyres:	Fr.L.	Continental: 3 mm	Fr.R.	Continental: 3 mm
	Re.L.	Continental: 6 mm	Re.R.	Continental: 6 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1339,52
Bumper F, Scratch(es), Acceptable	0,00



Bumper R, Scratch(es), Smart repair	110,64
-------------------------------------	--------



Rocker panel inner R R, Dent(s), Acceptable	0,00
---	------

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------




Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)	369,84
---	--------



Tailgate, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Door R R, Scratch(es), LI - Repair and paint (complete)	382,02
---	--------

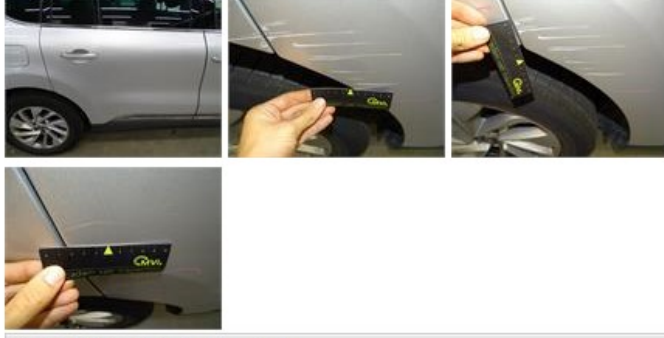

Spoiler R, Scratch(es), Acceptable	0,00
------------------------------------	------

No pictures to display

Wing F R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Door R L, Dent(s) and scratch(es), Acceptable	0,00
---	------

No pictures to display

Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)	282,02
---	--------

Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

362,02



Windscreen, Stone chip(s), E - Replace

0,00

