



RENAULT MEGANE GRANDTOUR: 1LHL528

Vinnumber:	VF1KZ0C0H53626331	Versionname:	1.5 DCI 95 TOMTOM? EDITION
First Registrationdate:	30/09/2015	Fiscalpower:	
Expertise Mileage:	128828	Power Kw:	70
Bodytype:	Break	Body color:	White
Gearbox:	MAN 6 VIT	Paint type:	Opaque
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3522
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	SD	Rear parking sensors	
Windows electric F		Type of Tow bar	Tow bar removable
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/91 H Steel			
Summer tyres:	Fr.L.	Goodyear: 4 mm	Fr.R.	Goodyear: 4 mm
	Re.L.	Goodyear: 3 mm	Re.R.	Goodyear: 3 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2225,53
--------------------------	----------------

Bodywork, Not original part, Acceptable	0,00
--	-------------




Wheel cover F L, Scratch(es), E - Replace

30,00



Windscreen, Crack, E - Replace

487,20

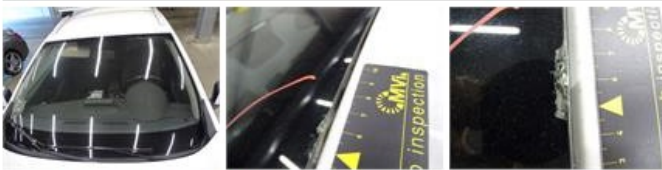

Trunk lid covering R, Scratch(es), Smart repair

110,64



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Sill outer L, Dent(s) and scratch(es), LI - Repair and paint (complete)

310,50



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20





Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Repaired, Acceptable 0,00

No pictures to display

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



Wheel cover F R, Scratch(es), E - Replace 30,00



Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete) 211,80



Wing F L, Scratch(es), Acceptable 0,00

No pictures to display

Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), Smart repair 110,64





Door R R, Dent(s) and scratch(es), Acceptable

0,00

No pictures to display