



VOLKSWAGEN PASSAT VARIANT: 1NJV063

Vinnumber:	WVWZZZ3CZGE155326	Versionname:	1.6 TDI VARIANT COMFORTLINE
First Registrationdate:	7/03/2016	Fiscalpower:	
Expertise Mileage:	89389	Power Kw:	88
Bodytype:	Break	Body color:	Light Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3533
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	SD	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	Tow bar fixed
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	215/60/16/99 H LightMetal			
Winter tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 7 mm	Re.R.	Michelin: 7 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT 2464,25

Alloy rim R R, Scratch(es), Acceptable 0,00

No pictures to display

Door F L, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display


Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Bonnet, Chemical pollution, LI - Repair and paint (complete)

290,08

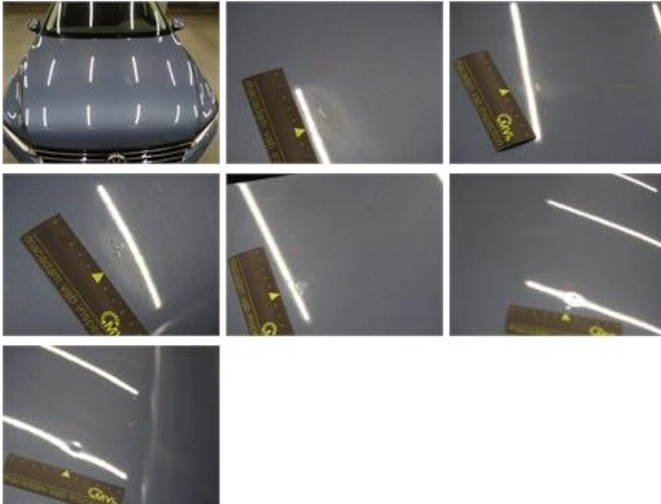

Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00



Seat cover F R, Hole, Smart repair

64,32




Wing R L, Scratch(es), Acceptable

0,00

No pictures to display

Trunk lid covering R, Scratch(es), Smart repair

110,64

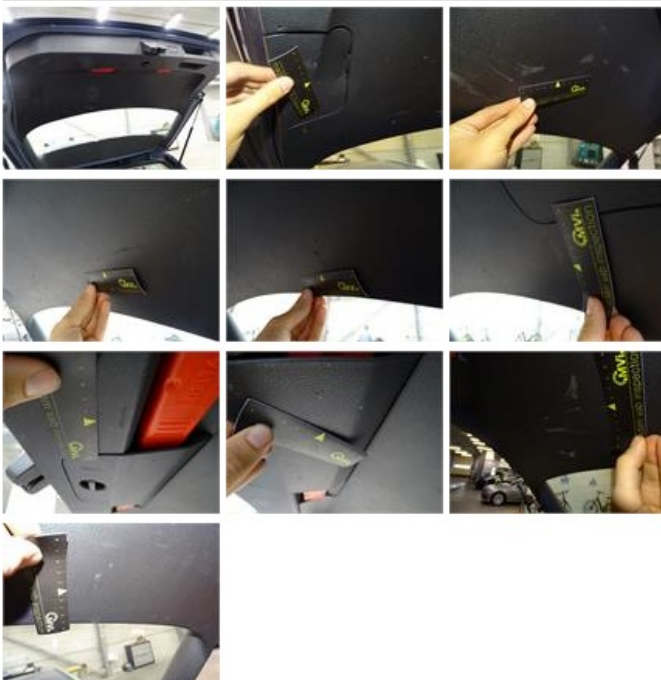

Rocker panel inner R R, Dent(s), LI - Repair and paint (complete)

115,56



Door R L, Chemical pollution, Acceptable 0,00

No pictures to display

Door F R, Dent(s), PDR - Paintless dent repair 63,00



Roof, Chemical pollution, LI - Repair and paint (complete) 481,50



Wing R R, Dent(s), PDR - Paintless dent repair 63,00



Bumper R, Crack, Le - Replace and paint 651,00





Wing F R, Chemical polution, Acceptable	0,00
---	------

No pictures to display

Bumper F, Scratch(es), LI - Repair and paint (complete)	211,80
---	--------

