



AUDI A6 AVANT: 1LAV942

Vinnumber:	WAUZZZ4G5GN049777	Versionname:	3.0 TDI 155KW S TRONIC QUATTRO S LINE
First Registrationdate:	5/08/2015	Fiscalpower:	
Expertise Mileage:	159006	Power Kw:	155
Bodytype:	Break	Body color:	Black
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	4 Weel	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4309
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	Tow bar fixed
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

255/40/19/100 Y LightMetal				
Summer tyres:	Fr.L.	Goodyear: 5 mm	Fr.R.	Goodyear: 5 mm
	Re.L.	Pirelli: 4 mm	Re.R.	Pirelli: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT 2406,98

Door R R, Scratch(es), Acceptable 0,00

No pictures to display

Covering interior B pillar L, Worn, Acceptable 0,00



Sill outer R, Scratch(es), Acceptable 0,00

No pictures to display

Wing F R, Scratch(es), Acceptable 0,00

No pictures to display


Bonnet, Stone chip(s), Acceptable 0,00

No pictures to display

Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete) 382,02

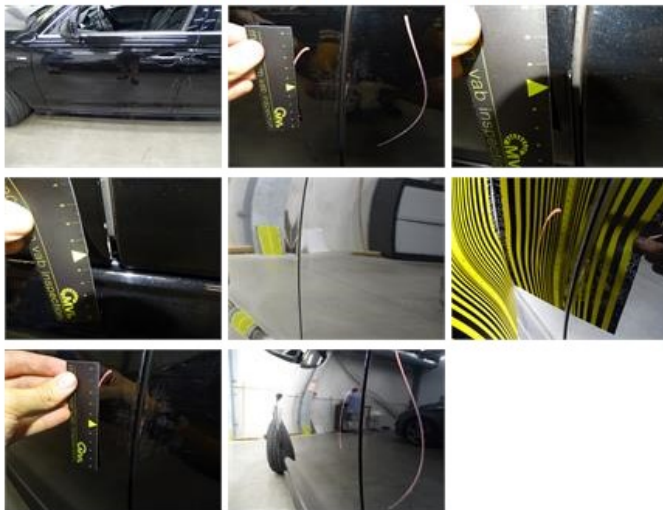

Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Sill outer L, Scratch(es), LI - Repair and paint (complete) 372,60



Bumper F, Scratch(es), LI - Repair and paint (complete) 254,16



Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete)

95,00



Tailgate, Scratch(es), Acceptable

0,00

No pictures to display

Rear window, Scratch(es), Acceptable

0,00



Bumper R, Scratch(es), LI - Repair and paint (complete)

254,16



Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

382,02





Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 382,02



Wing R R, Scratch(es), Acceptable 0,00

No pictures to display