



**BMW 3 GRAN TURISMO: 1JXD342**

Vinnumber:	<b>WBA3Y11080GD87480</b>	Versionname:	<b>2.0 318D (100KW) GRAN TURISMO</b>
First Registrationdate:	<b>11/03/2015</b>	Fiscalpower:	
Expertise Mileage:	<b>126651</b>	Power Kw:	<b>100</b>
Bodytype:		Body color	<b>Dark Brown</b>
Gearbox:	<b>MAN 6 VIT</b>	Body color	<b>BRUIN</b>
Transmission:	<b>Back</b>	Paint type	<b>Metalic</b>
Fueltype:	<b>Diesel</b>	Rims summer	<b>Aluminium</b>
Maintenance	<b>17000 KM</b>	Oil level	<b>OK</b>
Maintenance	<b>OK</b>	Parking lot	<b>2522</b>
Battery functioning	<b>Yes</b>		
Number of doors	<b>5</b>		
Number of seats	<b>5</b>		
Number head rests	<b>5</b>		
Rims summer	<b>Aluminium</b>		
Category	<b>Passenger Car</b>		
Oil level	<b>OK</b>		
Registration Certificate Car (BE)	<b>Yes</b>		

**Options**

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	<b>HD</b>	Rear parking sensors	
Windows electric F		Type of Tow bar	<b>No Tow bar</b>
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	<b>Headlighting Halogen</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining leather</b>		
Type of climate control	<b>Autom climate control</b>		
Adaptive cruise control			

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

<b>225/55/17/101 W LightMetal</b>				
Summer tyres:	Fr.L.	<b>Firestone: 4 mm</b>	Fr.R.	<b>Firestone: 4 mm</b>
	Re.L.	<b>Michelin: 7 mm</b>	Re.R.	<b>Michelin: 7 mm</b>

**Assistance equipment**

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		

Total cost ex VAT 256,40

Bonnet, Chemical polution, 67 - Polish 0,00


<i>No pictures to display</i>	
Alloy rim F R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Bumper F, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wing F R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Windscreen, Stone chip(s), Windscreen repair	58,80



Bumper R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door F L, Dent(s) and scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Alloy rim R R, Scratch(es), LI - Repair and paint (complete)	95,00



Wing R L, Dent(s), PDR - Paintless dent repair	102,60
--	--------

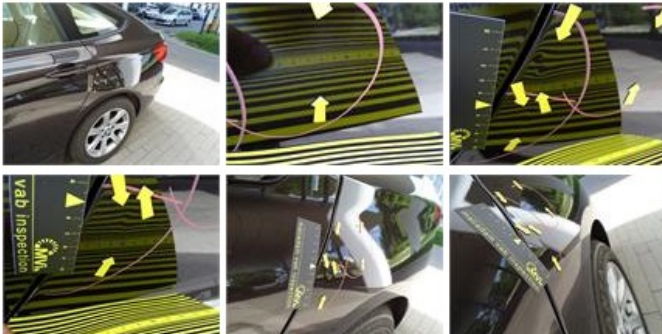

Door F R, Scratch(es), Acceptable	0,00
-----------------------------------	------

*No pictures to display*