



BMW 3 TOURING: 1LCE927

Vinnumber:	WBA8L71040K555343	Versionname:	2.0 316D (85KW) TOURING
First Registrationdate:	18/08/2015	Fiscalpower:	
Expertise Mileage:	105085	Power Kw:	85
Bodytype:	Break	Body color:	Dark Brown
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1425
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Front parking sensors	
GPS storage	HD	Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining artificial leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

205/60/16/92 W LightMetal				
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1559,94
Rear spoiler, Chemical polution, LI - Repair and paint (complete)	115,56

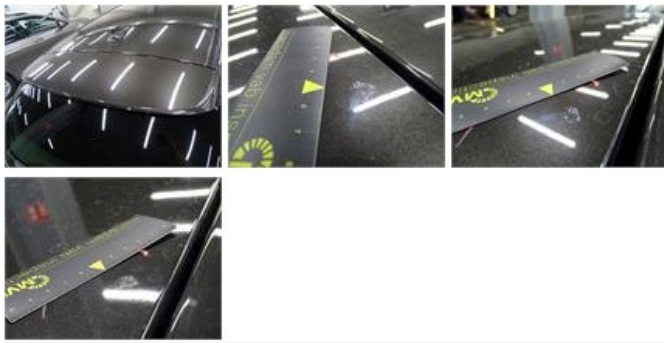

Alloy rim R L, Scratch(es), LI - Repair and paint (complete)

95,00



Luggage space cover, Missing, E - Replace

240,00



Rocker panel inner R L, Dent(s), LI - Repair and paint (complete)

115,56



Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

259,80



Wing F R, Scratch(es), LI - Repair and paint (complete)

220,18



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20



Roof, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Alloy rim F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Bumper F, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door R L, Dent(s) and scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Trunk lid covering R, Scratch(es), Smart repair	110,64



Alloy rim F R, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------



Seat cover F L, Worn, Acceptable	0,00
----------------------------------	------



Wing R L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door panel R R, Scratch(es), Acceptable	0,00

