



CITROEN GRAND C4 PICASSO: 1KJG615

Vinnumber:	VF73A9HC8FJ630872	Versionname:	1.6 E-HDI 115 MAN6 INTENSIVE
First Registrationdate:	11/05/2015	Fiscalpower:	
Expertise Mileage:	186383	Power Kw:	85
Bodytype:		Body color:	Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	2211
Maintenance:	8900		
Maintenance:	10 MAAND		
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/60/16/92 V LightMetal				
Summer tyres:	Fr.L.	Bridgestone: 3 mm	Fr.R.	Bridgestone: 3 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Total cost ex VAT	1417,68
-------------------	----------------

Seat cover R, Stain, Cleaning	25,00
-------------------------------	--------------



Windscreen, Stone chip(s), Windscreen repair 0,00



Door R L, Dent(s), PDR - Paintless dent repair 122,40



Seat cover F R, Stain, Cleaning 25,00



Alloy rim F L, Scratch(es), Acceptable 0,00

No pictures to display Mirror side blinker R, Scratch(es), Acceptable 0,00

No pictures to display Armrest F Mid, Tear, Acceptable 0,00

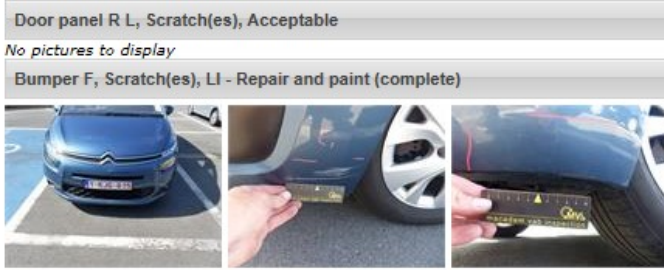
No pictures to display Sill outer R, Dent(s), Acceptable 0,00

No pictures to display Ceiling, Stain, Acceptable 0,00

No pictures to display Alloy rim F R, Scratch(es), Acceptable 0,00

No pictures to display Door panel R L, Scratch(es), Acceptable 0,00

No pictures to display Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80





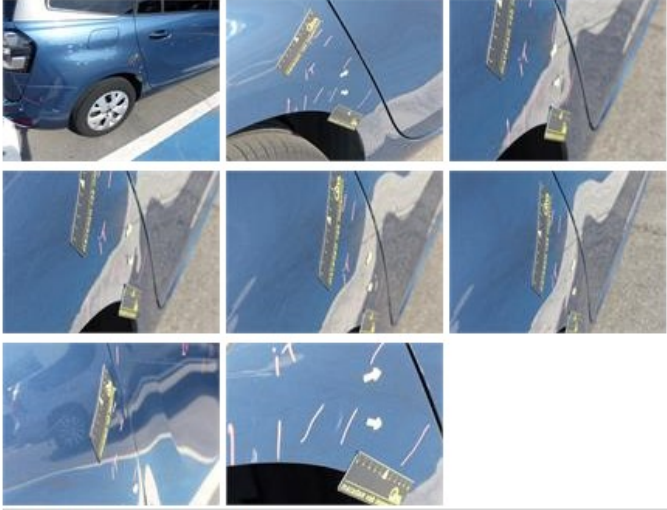

Wing R L, Dent(s), Acceptable 0,00

No pictures to display Outer backrest protection L, Scratch(es), Acceptable 0,00

No pictures to display Roof, Dent(s), Acceptable 0,00

No pictures to display Door frame R R, Scratch(es), Acceptable 0,00

No pictures to display

Sill trim R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Outer backrest protection R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Alloy rim R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)	318,35
	
Door F R, Scratch(es), LI - Repair and paint (complete)	0,00
	
Wing R R, Dent(s), It - Spot repair	0,00
	
Wing F R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door panel R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Sill outer L, Dent(s), Acceptable	0,00
<i>No pictures to display</i>	
Internal Boot Lining L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Outer door handle R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Floor covering F L, Hole, Smart repair	64,32
	
Trunk lid covering R, Broken, E - Replace	191,45



Bumper cover R M, Scratch(es), E - Replace 171,76



Internal Boot Lining R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 259,80



Wheel hub cap F R, Missing, E - Replace 27,80

