



BMW X1: 1KHR984

Vinnumber:	WBAVP91030VV50295	Versionname:	2.0 XDRIVE20D (120KW)
First Registrationdate:	6/05/2015	Fiscalpower:	
Expertise Mileage:	66530	Power Kw:	120
Bodytype:		Body color:	White
Gearbox:	Automatic	Paint type:	Opaque
Transmission:	4 Weel	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3121
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	Type of Tow bar
Radio multimedia	No Tow bar
Type of headlighting	Headlighting Halogen
Type of GPS	No GPS
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

225/50/17/98 V LightMetal			
Winter tyres:	Fr.L.	Fr.R.	Michelin: 5 mm
	Re.L.	Re.R.	Michelin: 5 mm

Assistance equipment

Repair kit	Yes
Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Total cost ex VAT	820,23
Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)	0,00

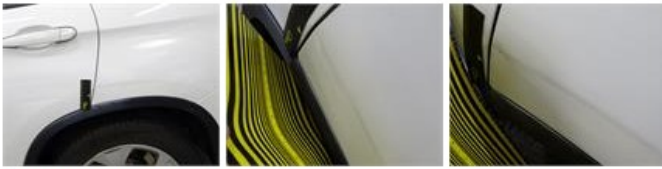

Alloy rim F R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Bumper F, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Chemical pollution, LI - Repair and paint (complete) 290,08

