



JAGUAR XF: 1HRH954

Vinnumber:	SAJAA01T3EDU18984	Versionname:	XF SPORTBRAKE 163PK Aut.
First Registrationdate:	12/09/2014	Fiscalpower:	
Expertise Mileage:	119075	Power Kw:	120
Bodytype:	Break	Body color:	Black
Gearbox:	Automatic	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2714
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Seats electric F L	
Windows electric F		Seats electric F R	
Windows electric R		Central consol F	
Cruise Control		Luggage cover	
Steering wheel multifunctional		Front parking sensors	
Radio multimedia		Rear parking sensors	
Type of headlighting	Headlighting Xenon	Type of Tow bar	No Tow bar
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

Winter tyres:	235/55/17/103 V LightMetal			
	Fr.L.	Bridgestone: 6 mm	Fr.R.	Bridgestone: 6 mm
	Re.L.	Uniroyal: 4 mm	Re.R.	Uniroyal: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	2999,50
-------------------	----------------

Bonnet, Scratch(es), 67 - Polish	0,00
----------------------------------	-------------

No pictures to display


Alloy rim R R, Deformed / Strained, E - Replace	277,44
---	---------------



Roof, Chemical polution, LI - Repair and paint (complete) 577,80



Rear window, Scratch(es), E - Replace 0,00

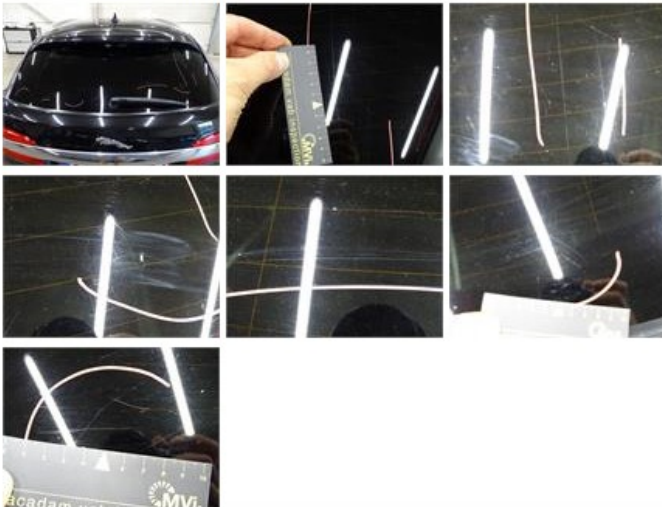


Door F L, Scratch(es), LI - Repair and paint (complete) 382,02



Door R L, Scratch(es), LI - Repair and paint (complete) 382,02



Door R R, Scratch(es), LI - Repair and paint (complete) 382,02

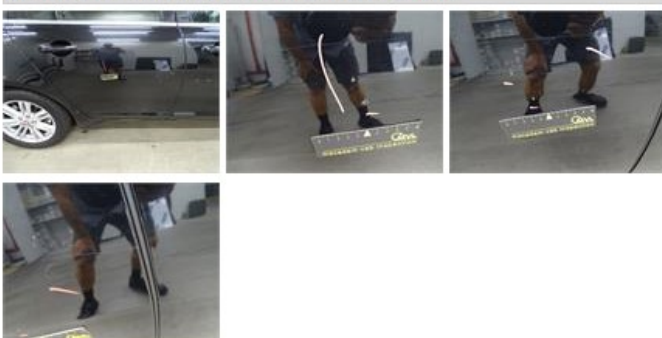

Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete) 254,16



Tailgate, Scratch(es), LI - Repair and paint (complete) 362,02



Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 382,02

