



MINI : 1LDN540

Vinnumber:	WMWXN110603A63641	Versionname:	1.5 ONE D
First Registrationdate:	28/08/2015	Fiscalpower:	
Expertise Mileage:	85822	Power Kw:	70
Bodytype:	Hatchback	Body color:	Brown
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3714
Number of doors:	3		
Number of seats:	4		
Number head rests:	4		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

GPS storage		Luggage cover	
GPS storage	HD	Type of Tow bar	No Tow bar
Windows electric F			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

175/65/15/84 H LightMetal				
Summer tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2850,33
Floor covering F L, Hole, E - Replace	252,00



Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Wing moulding F R, Scratch(es), E - Replace

14,40




Rearview mirror housing R, Scratch(es), Acceptable

0,00

No pictures to display


Rear window, Scratch(es), Acceptable

0,00

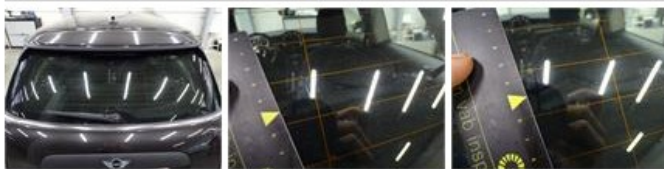


Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35

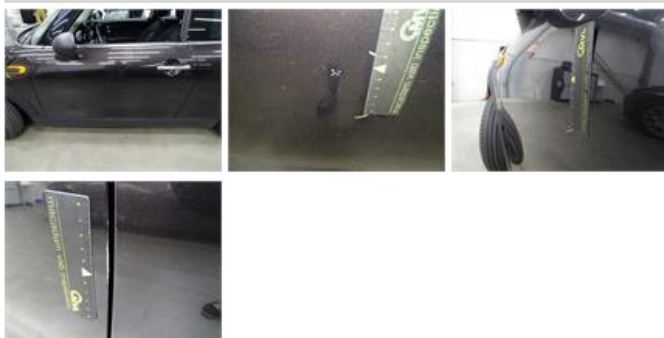

Roof, Chemical pollution, LI - Repair and paint (complete)

481,50

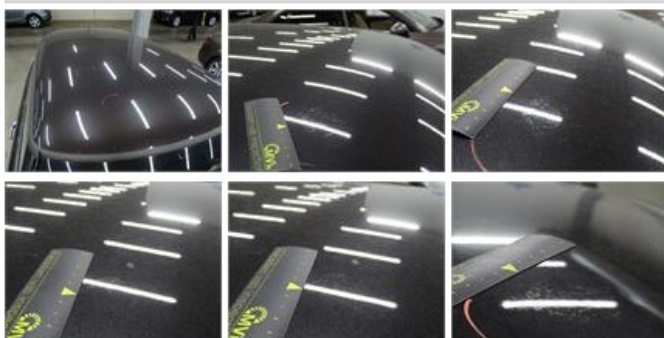

Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00



Alloy rim R R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R R, Scratch(es), LI - Repair and paint (complete) 308,20



Bonnet, Scratch(es), LI - Repair and paint (complete) 290,08



Windscreen, Stone chip(s), Acceptable 0,00



Ignition key, Missing, E - Replace 150,00

No pictures to display

Door panel F R, Tear, E - Replace 114,00





Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20



Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

211,80

