



RENAULT Trafic: 1HKG904

Vinnumber:	VF1FLB088EY782989	Versionname:	TRAFIC 29 B/F L2H1 Confort(E5)90PK
First Registrationdate:	8/08/2014	Fiscalpower:	
Expertise Mileage:	173375	Power Kw:	66
Bodytype:	Transporter	Body color:	White
Gearbox:	MAN 6 VIT	Paint type:	Opaque
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	LCV13
Number of doors:	5		
Number of seats:	3		
Number head rests:	3		
Rims summer:	Steel		
Category:	Light Commercial Vehicle		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Windows electric F	Central consol F
Radio multimedia	Type of Tow bar
Type of headlighting	Headlighting Halogen
Type of GPS	No GPS
Type of Lining	Lining fabrics
Type of climate control	No climate control
	Tow bar fixed

Limited Technical Inspection

Tires wear profile	OK	Battery functioning	Yes
Idle position	OK	Power steering	Yes
Engine startingtime	OK	Sound engine	OK
Exhaust gass	OK	Clutch test	OK
Handbrake	OK	Wiper fluid level	OK
		Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear


215/65/16/104 T Steel				
Summer tyres:	Fr.L.	Goodyear: 4 mm	Fr.R.	Goodyear: 4 mm
	Re.L.	Goodyear: 8 mm	Re.R.	Goodyear: 8 mm

Assistance equipment

Spare wheel	Yes
Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Total cost ex VAT	1797,69
Roof, Dent(s) and scratch(es), LI - Repair and paint (complete)	409,13



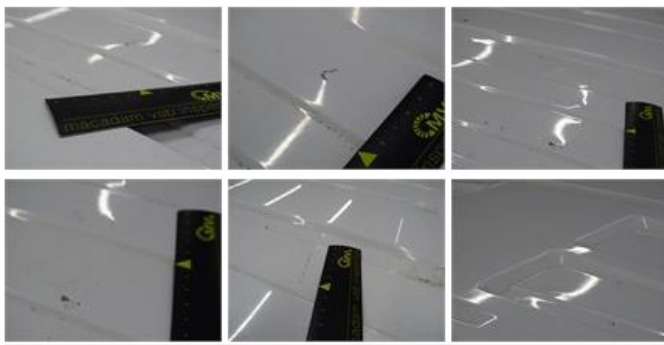

Bumper R, Scratch(es), Smart repair

110,64



Wing R R, Dent(s) and scratch(es), Le - Replace and paint

0,00



Wheel cover F R, Scratch(es), Acceptable

0,00

No pictures to display

Central pillar L, Scratch(es), Acceptable

0,00

No pictures to display

Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

238,76



Windscreen, Scratch(es), E - Replace

0,00



Wing F L, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Dent(s), Acceptable 0,00

No pictures to display

Seat cover F R, Hole, E - Replace 300,00



Bumper corner R R, Scratch(es), Smart repair 110,64



Central pillar R, Scratch(es), Acceptable 0,00

No pictures to display

Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 238,76



Bonnet, Dent(s), Acceptable 0,00

No pictures to display

Bumper F, Scratch(es), Smart repair 110,64





Rocker panel inner F R, Dent(s), LI - Repair and paint (complete)	115,56
---	--------



Trunk door R R, Dent(s) and scratch(es), Acceptable	0,00
---	------

No pictures to display

Door F R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Roof pillar R, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Wing trim R R, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Trunk door R L, Dent(s) and scratch(es), It - Spot repair	163,56
---	--------



Rearview mirror housing L, Scratch(es), Acceptable	0,00
--	------

No pictures to display