



RENAULT Kangoo Express: 1FWL721

Vinnumber:	VF1FW18B549967648	Versionname:	KANGOO EXPR.B/F Gr.Confort 90PK
First Registrationdate:	19/11/2013	Fiscalpower:	
Expertise Mileage:	161399	Power Kw:	66
Bodytype:	Transporter	Body color:	White
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2525
Number of doors:	5		
Number of seats:	2		
Number head rests:	2		
Rims summer:	Steel		
Category:	Light Commercial Vehicle		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Rear parking sensors
Radio multimedia	Type of Tow bar
Type of headlighting	Headlighting Halogen
Type of GPS	No GPS
Type of Lining	Lining fabrics
Type of climate control	Manual climate control
	No Tow bar

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

195/65/15/91 H Steel				
Summer tyres:	Fr.L.	Kleber: 5 mm	Fr.R.	Kleber: 5 mm
	Re.L.	Continental: 6 mm	Re.R.	Continental: 6 mm

Assistance equipment

Spare wheel	Yes
-------------	------------

Total cost ex VAT	1221,04
-------------------	---------

Wheel cover F L, Scratch(es), E - Replace	22,50
---	-------





Wheel cover R R, Scratch(es), E - Replace 22,50



Door R R, Scratch(es), Acceptable 0,00

No pictures to display


Wing F L, Scratch(es), Acceptable 0,00

No pictures to display


Door F L, Rust, LI - Repair and paint (complete) 238,76



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 231,15

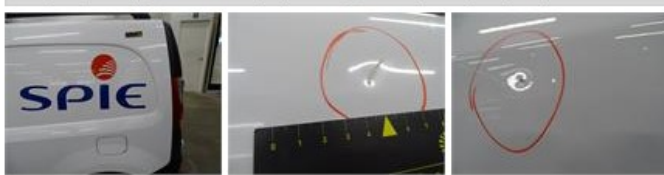

Roof, Dent(s), LI - Repair and paint (complete) 361,13

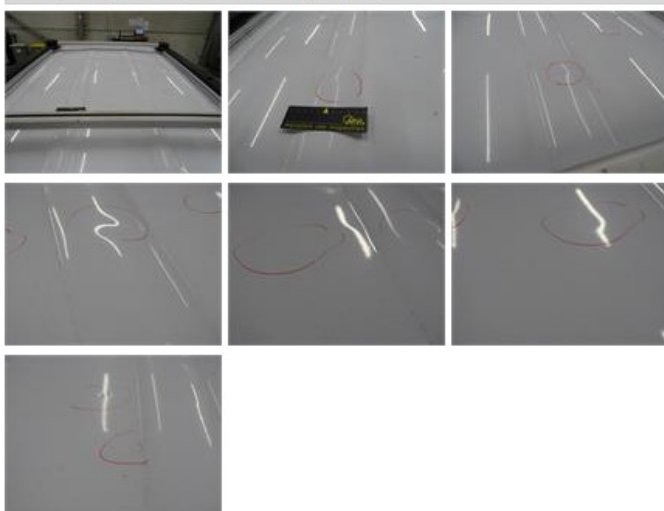

Wheel cover F R, Scratch(es), E - Replace 22,50



Door R R, Scratch(es), 67 - Polish 0,00

No pictures to display

Bonnet, Stone chip(s), Acceptable 0,00

No pictures to display

Wheel cover R L, Scratch(es), E - Replace 22,50



Wing R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Seat cover F L, Damaged, E - Replace	300,00

