



RENAULT Scenic: 1KGZ78

Vinnumber:	VF1JZ14K652396206	Versionname:	SCENIC Energy Life 110PK
First Registrationdate:	4/05/2015	Fiscalpower:	
Expertise Mileage:	116674	Power Kw:	81
Bodytype:		Body color:	Silver
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2631
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F	
Windows electric F	Luggage cover	
Windows electric R	Front parking sensors	
Cruise Control	Rear parking sensors	
Steering wheel multifunctional	Type of Tow bar	Tow bar fixed
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining fabrics	
Type of climate control	Manual climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/60/16/92 H Steel			
Summer tyres:	Fr.L.	Uniroyal: 3 mm	Fr.R.	Uniroyal: 3 mm
	Re.L.	Uniroyal: 5 mm	Re.R.	Uniroyal: 5 mm


Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT 1108,05

Roof, Dent(s) and scratch(es), LI - Repair and paint (complete) 481,50



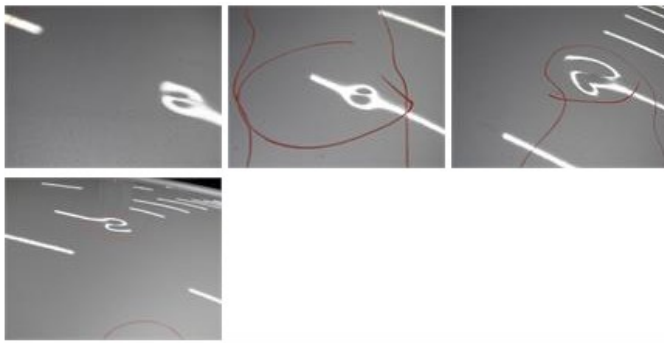

Door F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Bumper F, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door R L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Bumper corner R L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wheel cover R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Rearview mirror housing R, Scratch(es), 67 - Polish	0,00
<i>No pictures to display</i>	
Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)	318,35



Bonnet, Dent(s), Acceptable	0,00
<i>No pictures to display</i>	
Wheel cover F R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wing R L, Scratch(es), LI - Repair and paint (complete)	308,20

