


PEUGEOT 2008: 1NFR236

Vinnumber:	VF3CUBHY6GY020682	Versionname:	1.6 BLUEHDI 74KW S/S ACTIVE
First Registrationdate:	12/02/2016	Fiscalpower:	
Expertise Mileage:	39864	Power Kw:	73
Bodytype:		Body color:	Grey
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4711
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

GPS storage		Luggage cover	
GPS storage	HD	Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	195/60/16/89 H Steel			
Summer tyres:	Fr.L.	Goodyear: 5 mm	Fr.R.	Goodyear: 5 mm
	Re.L.	Goodyear: 6 mm	Re.R.	Goodyear: 6 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1885,02
Wing F L, Dent(s) and scratch(es), LI - Repair and paint (complete)	220,18



Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80



Wing R L, Scratch(es), Acceptable 0,00

No pictures to display

Door R L, Bad repair, Acceptable 0,00



Wheel cover F L, Scratch(es), E - Replace 30,00



Wheel cover R L, Scratch(es), Acceptable 0,00

No pictures to display

Certificate Of Conformity, Missing, E - Replace 150,00

No pictures to display

Wheel cover R R, Scratch(es), E - Replace 30,00






Tailgate, Dent(s), Acceptable 0,00

No pictures to display

Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 220,18

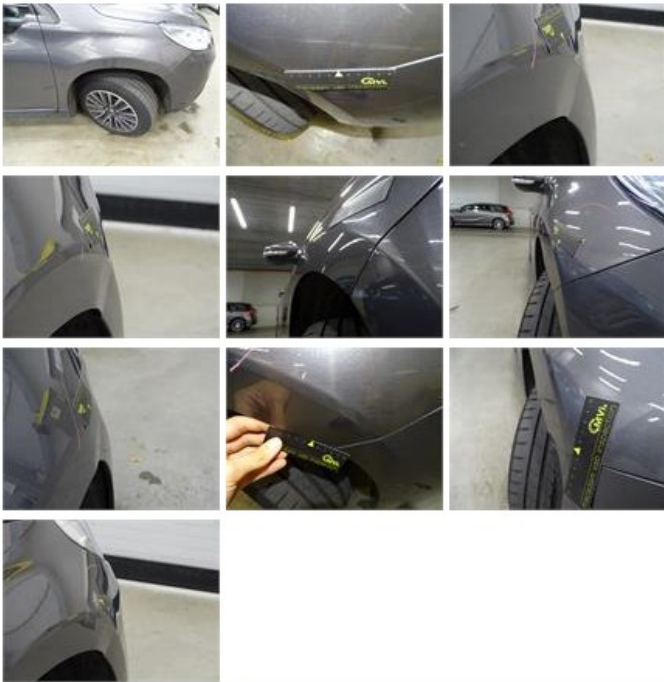

Roof, Chemical pollution, LI - Repair and paint (complete) 481,50



Bumper F M, Scratch(es), Smart repair 110,64




Bumper R, Dent(s) and scratch(es), Smart repair 110,64





Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08

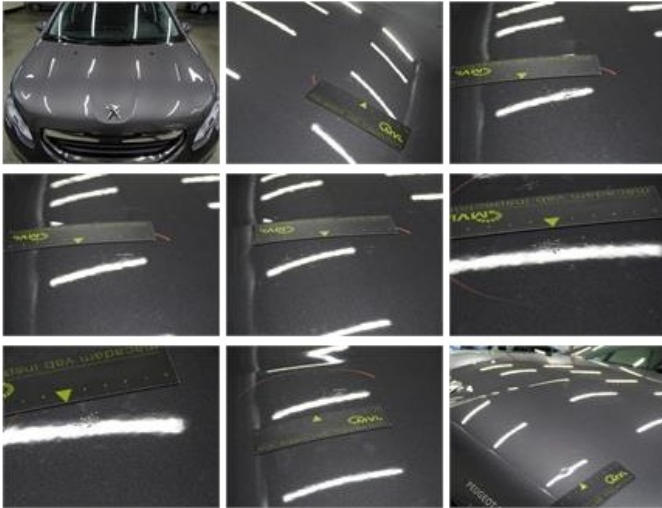

Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Rear spoiler, Dent(s), Acceptable 0,00

No pictures to display

Door R R, Scratch(es), Acceptable 0,00

No pictures to display

Wheel cover F R, Scratch(es), E - Replace 30,00

