



SEAT LEON ST: 1KTZ586

Vinnumber:	VSSZZZ5FZFR082534	Versionname:	1.6 TDI STYLE
First Registrationdate:	2/07/2015	Fiscalpower:	
Expertise Mileage:	91527	Power Kw:	77
Bodytype:		Body color:	Grey
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	NOT OK	Parking lot:	3616
Maintenance:	ENTRETIEN A FAIRE		
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F
GPS storage		Luggage cover
GPS storage	SD	Front parking sensors
Windows electric F		Rear parking sensors
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Radio multimedia		
Type of headlighting	Headlighting LED	
Type of GPS	GPS big screen color	
Type of Lining	Lining fabrics	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/91 H LightMetal			
Winter tyres:	Fr.L.	Michelin: 6 mm	Fr.R.	Michelin: 6 mm
	Re.L.	Michelin: 7 mm	Re.R.	Michelin: 7 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Total cost ex VAT	1328,22
-------------------	---------

Door F L, Dent(s) and scratch(es), Acceptable	0,00
---	------

No pictures to display

Wing F L, Dent(s), LI - Repair and paint (complete)	268,18
---	--------



Internal Boot Lining L, Scratch(es), E - Replace

26,02



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00



Internal Boot Lining R, Scratch(es), E - Replace

26,02



Bumper F, Scratch(es), Acceptable

0,00

No pictures to display

Rear window, Not original part, Remove lettering

25,00



Tires, Out of tolerance, P - Check

0,00



Tailgate, Dent(s), PDR - Paintless dent repair

63,00



Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00



Bonnet, Dent(s), PDR - Paintless dent repair

82,80



Bumper grille, Broken, E - Replace

32,40




Seat cover R, Stain, Cleaning

25,00



Roof, Dent(s), PDR - Paintless dent repair

102,60

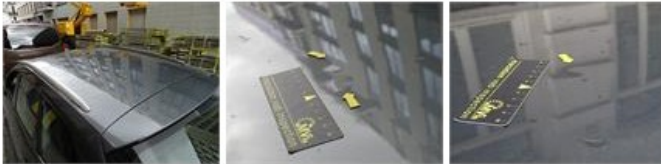

Windscreen, Scratch(es), E - Replace

487,20



Maintenance, Maintenance, Execute

0,00

