



MERCEDES C BREAK: 1KPD042

Vinnumber:	WDD2052371F202722	Versionname:	1.6 C 200 BLUETEC AVANTGARDE
First Registrationdate:	8/06/2015	Fiscalpower:	
Expertise Mileage:	142586	Power Kw:	100
Bodytype:	Break	Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4232
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	SD	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting LED		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/50/17/94 V LightMetal				
Summer tyres:	Fr.L.	Continental: 5 mm	Fr.R.	Continental: 5 mm
	Re.L.	Continental: 5 mm	Re.R.	Continental: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1107,51
Bumper F, Scratch(es), LI - Repair and paint (complete)	211,80




Door F L, Bad repair, Acceptable 0,00



Instrument panel cover, Worn, Acceptable 0,00



Trunk lid covering R, Scratch(es), Smart repair 110,64

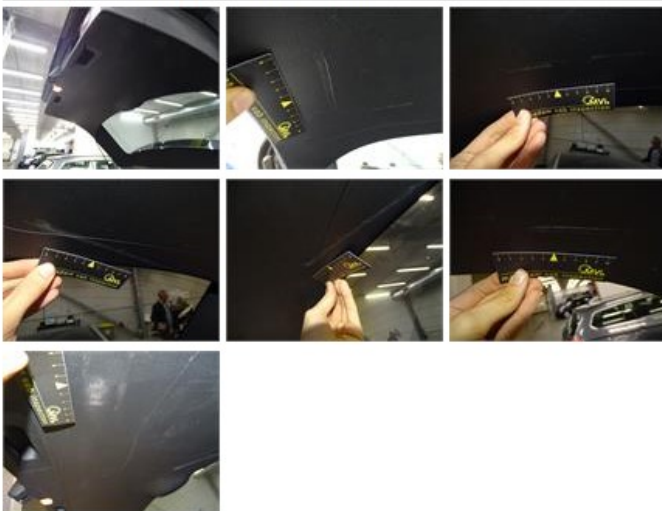


Wing R R, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08



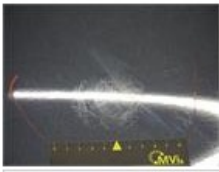

Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Roof pillar R, Chemical polution, LI - Repair and paint (complete) 220,18



Wing F R, Scratch(es), LI - Repair and paint (complete) 220,18



Door R R, Scratch(es), Acceptable 0,00

No pictures to display

Wheel arch cover F R, Missing, E - Replace 54,63

