



**VOLKSWAGEN Sharan: 1GVG479**

Vinnumber:	<b>WVWZZZ7NZEV037434</b>	Versionname:	<b>SHARAN Comfortline BMT 115PK</b>
First Registrationdate:	<b>9/05/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>142542</b>	Power Kw:	<b>85</b>
Bodytype:		Body color:	<b>Black</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2622</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>7</b>		
Number head rests:	<b>7</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	<b>HD</b>	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	<b>No Tow bar</b>
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	<b>Headlighting Halogen</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining fabrics</b>		
Type of climate control	<b>Autom climate control</b>		

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>


**Degree of wear**

<b>215/60/16/95 H LightMetal</b>				
Summer tyres:	Fr.L.	<b>Continental: 5 mm</b>	Fr.R.	<b>Continental: 5 mm</b>
	Re.L.	<b>Continental: 7 mm</b>	Re.R.	<b>Continental: 7 mm</b>

**Assistance equipment**

Number of charging cables (normal)	<b>0</b>
Number of charging cables (rapid charge)	<b>0</b>

Total cost ex VAT	<b>0,00</b>
Door panel R L, Scratch(es), Acceptable	<b>0,00</b>
<i>No pictures to display</i>	
Rearview mirror housing R, Scratch(es), Acceptable	<b>0,00</b>
<i>No pictures to display</i>	
Trunk lid covering R, Scratch(es), Smart repair	<b>0,00</b>

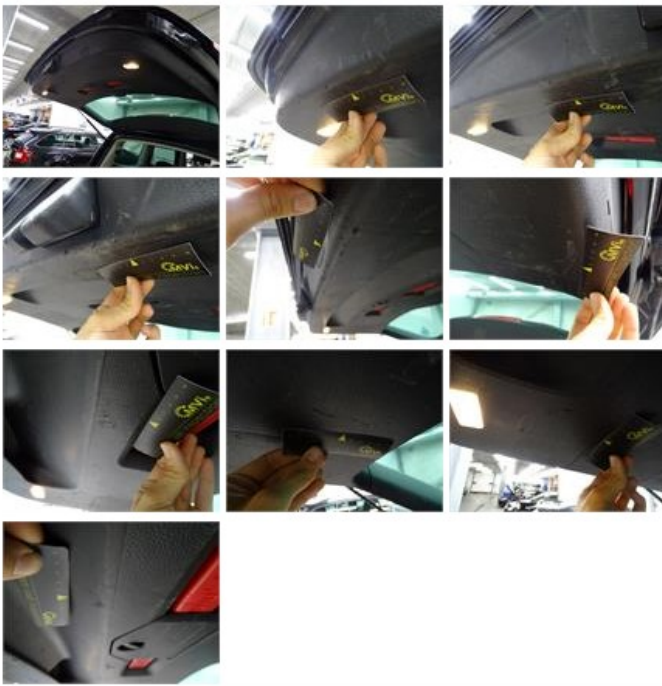

Door F R, Deformed / Strained, LI - Repair and paint (complete)

0,00



Sill trim R R, Scratch(es), Smart repair

0,00



Bumper R, Scratch(es), LI - Repair and paint (complete)

0,00



Alloy rim R L, Scratch(es), LI - Repair and paint (complete)

0,00





Door R R, Scratch(es), Acceptable 0,00

*No pictures to display*

Bonnet, Chemical polution, 67 - Polish 0,00

*No pictures to display*

Wheel hub cap R R, Missing, E - Replace 0,00



Roof, Dent(s) and scratch(es), Acceptable 0,00

*No pictures to display*

Seat Mid M compl, Worn, Acceptable 0,00



Door F L, Scratch(es), Acceptable 0,00

*No pictures to display*


Wheel hub cap F L, Missing, E - Replace 0,00



Backrest cover R M, Missing, E - Replace 0,00



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 0,00

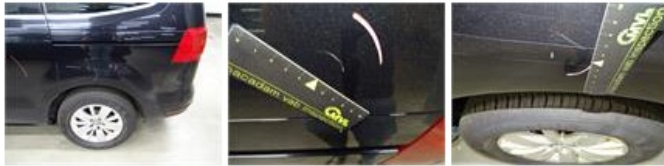

Bumper F, Scratch(es), LI - Repair and paint (complete) 0,00





Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

0,00




Tailgate, Dent(s) and scratch(es), LI - Repair and paint (complete)

0,00



Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

0,00

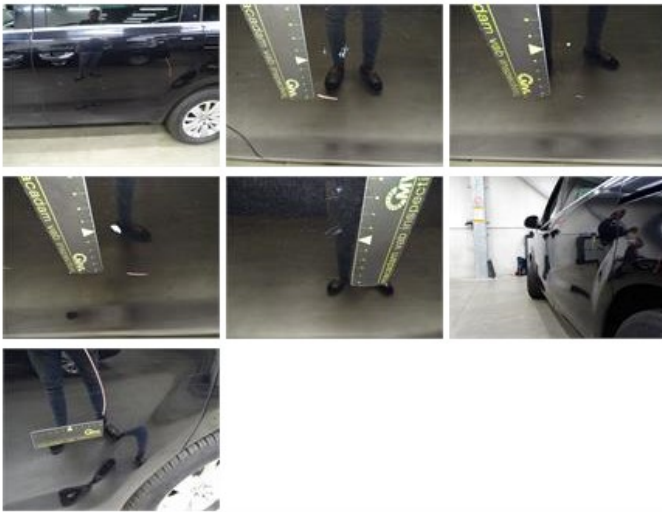

Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

0,00



Wing F L, Scratch(es), Acceptable

0,00

No pictures to display

Door panel R R, Scratch(es), Acceptable

0,00

No pictures to display