



**CITROEN C4 Picasso: 1HEJ601**

Vinnumber:	<b>VF73D9HC8EJ701564</b>	Versionname:	<b>C4 PICASSO e-HDi Business GPS 114PK</b>
First Registrationdate:	<b>1/07/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>131851</b>	Power Kw:	<b>85</b>
Bodytype:		Body color:	<b>Black</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Maintenance:	<b>14100KM</b>	Parking lot:	<b>1721</b>
Maintenance:	<b>OK</b>		
Battery functioning:	<b>Yes</b>		
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

GPS storage:	<b>HD</b>	Luggage cover:	
GPS storage:		Rear parking sensors:	
Windows electric F:		Type of Tow bar:	<b>No Tow bar</b>
Windows electric R:			
Cruise Control:			
Steering wheel multifunctional:			
Radio multimedia:			
Type of headlighting:	<b>Headlighting Halogen</b>		
Type of GPS:	<b>GPS big screen color</b>		
Type of Lining:	<b>Lining fabrics</b>		
Type of climate control:	<b>Autom climate control</b>		

**Limited Technical Inspection**

Airco functioning:	<b>OK</b>	Battery functioning:	<b>Yes</b>
Tires wear profile:	<b>OK</b>	Power steering:	<b>Yes</b>
Idle position:	<b>OK</b>	Sound engine:	<b>OK</b>
Engine startingtime:	<b>OK</b>	Clutch test:	<b>OK</b>
Exhaust gass:	<b>OK</b>	Wiper fluid level:	<b>OK</b>
Handbrake:	<b>OK</b>	Transmission:	<b>OK</b>
		Lighting:	<b>OK</b>
		Wiperblades:	<b>OK</b>

**Degree of wear**

<b>205/55/16/92 H LightMetal</b>				
Summer tyres:	Fr.L.	<b>Michelin: 1 mm</b>	Fr.R.	<b>Michelin: 1 mm</b>
	Re.L.	<b>Michelin: 3 mm</b>	Re.R.	<b>Michelin: 2 mm</b>

**Assistance equipment**

Emergency spare wheel:	<b>Yes</b>
------------------------	------------

Total cost ex VAT:	<b>1871,13</b>
Roof pillar L, Scratch(es), Acceptable:	<b>0,00</b>



Armrest L, Hole, E - Replace

227,31



Seat cover R L, Burned, Smart repair

64,32



Bonnet, Stone chip(s), Acceptable

0,00



Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Tyre F L, Worn, Acceptable

0,00



Seat cover F R, Stain, Cleaning

25,00



Sill outer L, Dent(s), PDR - Paintless dent repair

63,00



Windscreen, Stone chip(s), E - Replace

0,00



Floor covering F L, Hole, E - Replace

252,00




Tailgate, Scratch(es), LI - Repair and paint (complete)

301,68



Door R L, Dent(s), PDR - Paintless dent repair

0,00

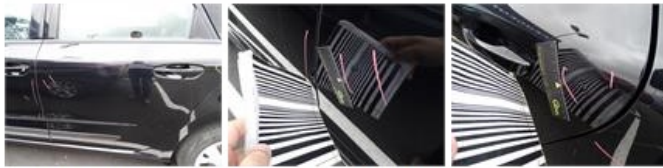

Wing R R, Scratch(es), LI - Repair and paint (complete)

0,00



Tyre F R, Worn, Acceptable

0,00



Wing R L, Scratch(es), LI - Repair and paint (complete)

0,00



Seat cover R R, Stain, Cleaning

25,00



Door F L, Scratch(es), LI - Repair and paint (complete)

318,35



Wing F R, Scratch(es), Acceptable

0,00





Seat cover F L, Burned, Smart repair

64,32



Door F R, Scratch(es), Acceptable

0,00



Door R R, Scratch(es), LI - Repair and paint (complete)

318,35

