



BMW 4 GRAN COUPE: 1LSJ215

Vinnumber:	WBA4E71050GS99659	Versionname:	2.0 418D (100KW) GRAN COUPE
First Registrationdate:	23/11/2015	Fiscalpower:	
Expertise Mileage:	190162	Power Kw:	100
Bodytype:		Body color:	White
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4310
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Sun Roof electric	
Windows electric F	Central consol F	
Windows electric R	Luggage cover	
Cruise Control	Front parking sensors	
Steering wheel multifunctional	Rear parking sensors	
Seats F heated	Type of Tow bar	No Tow bar
Radio multimedia		
Type of headlighting	Headlighting Xenon	
Type of GPS	GPS big screen color	
Type of Lining	Lining leather	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

205/60/16/92 W LightMetal			
Summer tyres:	Fr.L. Goodyear: 4 mm	Fr.R. Goodyear: 4 mm	
	Re.L. Goodyear: 4 mm	Re.R. Goodyear: 4 mm	

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2324,52
Tailgate, Dent(s), LI - Repair and paint (complete)	362,02

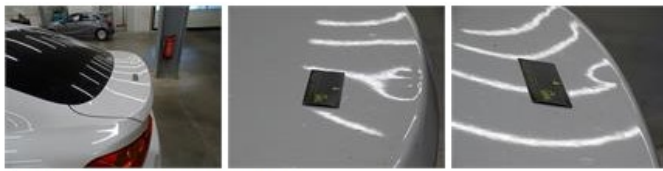

Alloy rim R L, Scratch(es), Acceptable 0,00

No pictures to display

Door R R, Scratch(es), LI - Repair and paint (complete) 382,02



Bumper F, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Rust, LI - Repair and paint (complete) 369,84



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 369,84



Bumper R, Crack, Le - Replace and paint 766,80



Protection plate M, Deformed / Strained, E - Replace 74,00

