



VOLKSWAGEN GOLF VII: 1JRP038

Vinnumber:	WVWZZZAUZFP072567	Versionname:	1.6 TDI TRENDLINE
First Registrationdate:	9/02/2015	Fiscalpower:	
Expertise Mileage:	63542	Power Kw:	77
Bodytype:		Body color:	Black
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	2331
Maintenance:	IN 21000 KM		
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F
GPS storage	SD	Luggage cover
GPS storage		Front parking sensors
Windows electric F		Rear parking sensors
Cruise Control		
Steering wheel multifunctional		
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining fabrics	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	NOT OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

195/65/15/91 H Steel				
Summer tyres:	Fr.L.	Goodyear: 6 mm	Fr.R.	Goodyear: 6 mm
	Re.L.	Continental: 7 mm	Re.R.	Continental: 7 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Total cost ex VAT	522,60
-------------------	---------------


Floor covering F L, Worn, Acceptable	0,00
--------------------------------------	-------------

No pictures to display


Wheel cover F R, Scratch(es), Acceptable	0,00
--	-------------

No pictures to display

Door F R, Dent(s) and scratch(es), Le - Replace and paint	0,00
---	-------------

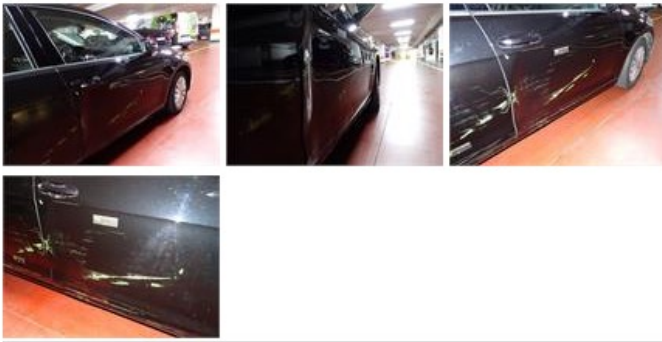

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 0,00

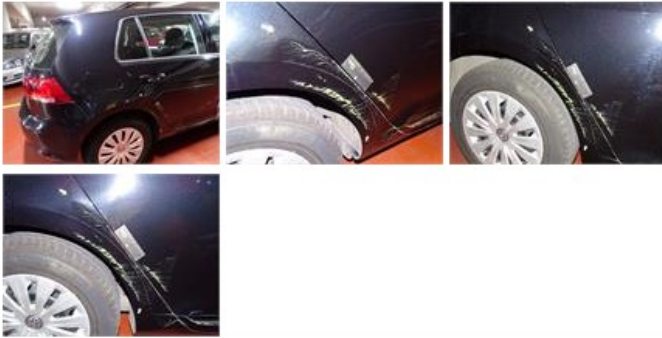

Interior, Stain, Cleaning 75,00



Door R R, Dent(s) and scratch(es), Le - Replace and paint 0,00



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Bonnet, Stone chip(s), Acceptable 0,00

No pictures to display

Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete) 235,80



Sill outer R, Dent(s) and scratch(es), Le - Replace and paint 0,00



Wheel cover R R, Scratch(es), Acceptable 0,00

No pictures to display

Windscreen, Stone chip(s), Windscreen repair 0,00

