



BMW 5 BERLINE: 1LAL397

| | | | |
|------------------------------------|--------------------------|--------------|-------------------------|
| Vinnumber: | WBA5E51040G068163 | Versionname: | 2.0 520D (120KW) |
| First Registrationdate: | 3/08/2015 | Fiscalpower: | |
| Expertise Mileage: | 112551 | Power Kw: | 120 |
| Bodytype: | Berline | Body color: | Brown |
| Gearbox: | Automatic | Paint type: | Metalic |
| Transmission: | Back | Rims summer: | Aluminium |
| Fueltype: | Diesel | Oil level: | OK |
| Battery functioning: | Yes | Parking lot: | 3526 |
| Number of doors: | 4 | | |
| Number of seats: | 5 | | |
| Number head rests: | 5 | | |
| Rims summer: | Aluminium | | |
| Category: | Passenger Car | | |
| Oil level: | OK | | |
| Registration Certificate Car (BE): | Yes | | |

Options

| | | | |
|--------------------------------|------------------------------|-----------------------|--------------------------|
| Radio CD | | Central consol F | |
| GPS storage | | Front parking sensors | |
| GPS storage | HD | Rear parking sensors | |
| Windows electric F | | Type of Tow bar | Tow bar removable |
| Windows electric R | | | |
| Cruise Control | | | |
| Steering wheel multifunctional | | | |
| Seats F heated | | | |
| Radio multimedia | | | |
| Type of headlighting | Headlighting Xenon | | |
| Type of GPS | GPS big screen color | | |
| Type of Lining | Lining leather | | |
| Type of climate control | Autom climate control | | |

Limited Technical Inspection

| | | | |
|---------------------|-----------|---------------------|------------|
| Airco functioning | OK | Battery functioning | Yes |
| Tires wear profile | OK | Power steering | Yes |
| Idle position | OK | Sound engine | OK |
| Engine startingtime | OK | Clutch test | OK |
| Exhaust gass | OK | Wiper fluid level | OK |
| Handbrake | OK | Transmission | OK |
| | | Lighting | OK |
| | | Wiperblades | OK |

Degree of wear

| | | | | |
|-----------------------------------|-------|--------------------------|-------|--------------------------|
| 225/55/17/101 V LightMetal | | | | |
| Winter tyres: | Fr.L. | Continental: 5 mm | Fr.R. | Continental: 5 mm |
| | Re.L. | Continental: 3 mm | Re.R. | Continental: 3 mm |

Assistance equipment

| | | | |
|--|------------|------------|------------|
| Repair kit | Yes | Compressor | Yes |
| Number of charging cables (normal) | 0 | | |
| Number of charging cables (rapid charge) | 0 | | |

Total cost ex VAT 2022,20

Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Wing F R, Bad repair, Acceptable 0,00

No pictures to display

Alloy rim R L, Scratch(es), LI - Repair and paint (complete)

95,00



Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00



Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

382,02



Door panel F L, Worn, Acceptable

0,00



Door R R, Scratch(es), LI - Repair and paint (complete)

382,02



Bumper R, Scratch(es), LI - Repair and paint (complete)

254,16



Bonnet, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 369,84




Tailgate, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete) 254,16

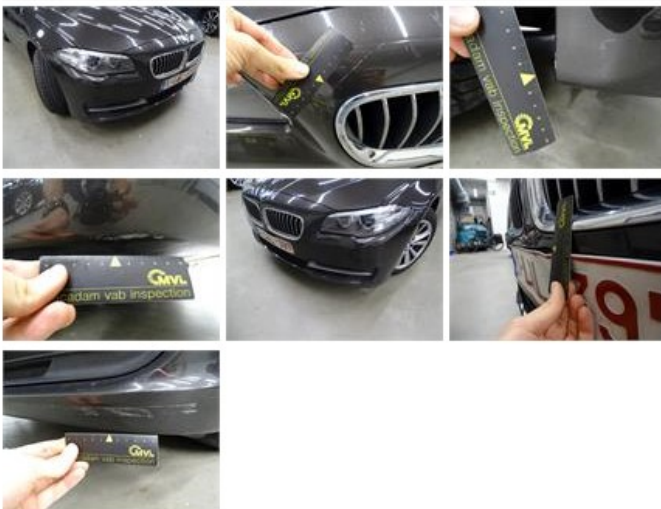

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00

