



LAND ROVER RANGE ROVER EVOQUE: 1PCF437

Vinnumber:	SALVA2BN6GH121742	Versionname:	2.0 TD4 110KW SE DYNAMIC 4WD AUTO
First Registrationdate:	2/06/2016	Fiscalpower:	
Expertise Mileage:	67472	Power Kw:	110
Bodytype:	Off-road	Body color:	Black
Gearbox:	Automatic	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2527
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Seats electric F L	
Windows electric F		Seats electric F R	
Windows electric R		Central consol F	
Cruise Control		Front parking sensors	
Steering wheel multifunctional		Rear parking sensors	
Seats F heated		Type of Tow bar	Tow bar removable
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	235/60/18/103 V LightMetal			
Summer tyres:	Fr.L.	Michelin: 3 mm	Fr.R.	Michelin: 3 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT 1852,20

Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 382,02



Door F L, Scratch(es), LI - Repair and paint (complete)

382,02



Rocker panel inner R L, Dent(s), LI - Repair and paint (complete)

115,56




Luggage space cover, Missing, E - Replace

288,00



Door R R, Scratch(es), LI - Repair and paint (complete)

382,02

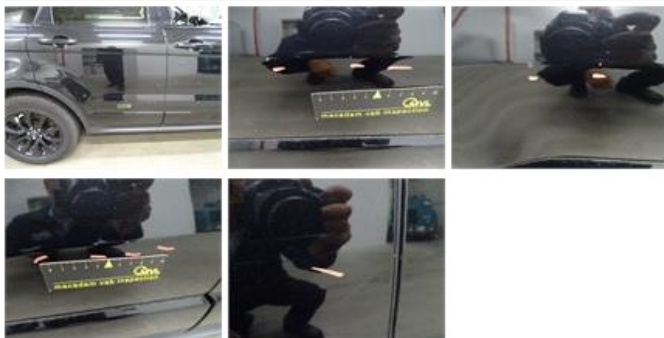

Wing R L, Scratch(es), Acceptable

0,00

No pictures to display

Wing R R, Scratch(es), Acceptable

0,00

No pictures to display

Interior, Smell, Ozone treatment

152,58



Door R L, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim F L, Scratch(es), Acceptable

0,00

No pictures to display

Bonnet, Stone chip(s), Acceptable

0,00

No pictures to display

Boot carpet, Dirty, Chemical cleaning

150,00

