


FORD Focus: 1FTP099

Vinnnummer:	WF0LXXGCBLDK84051	Versionname:	FOCUS CLIP. ECONetic Trend 88g 105PK
First Registrationdate:	21/10/2013	Fiscalpower:	
Expertise Mileage:	159361	Power Kw:	77
Bodytype:	Break	Body color:	Silver
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1311
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Luggage cover	
GPS storage		Rear parking sensors	
GPS storage	SD	Type of Tow bar	No Tow bar
Windows electric F			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/91 V Steel			
Summer tyres:	Fr.L.	Michelin: 6 mm	Fr.R.	Michelin: 6 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1567,76
-------------------	---------

Ignition key, Missing, E - Replace	150,00
------------------------------------	--------

No pictures to display

Door F R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Bonnet, Scratch(es), Acceptable	0,00
---------------------------------	------

No pictures to display

Wheel cover R R, Scratch(es), E - Replace

30,00




Tailgate, Scratch(es), Acceptable

0,00

No pictures to display

Rear window, Scratch(es), E - Replace

370,00

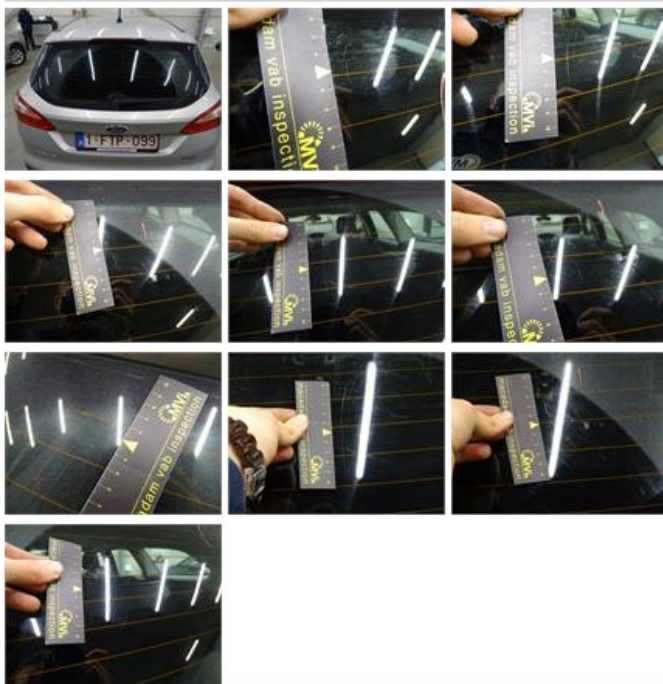


Bumper R, Scratch(es), Smart repair

110,64



Door R R, Dent(s), PDR - Paintless dent repair

63,00

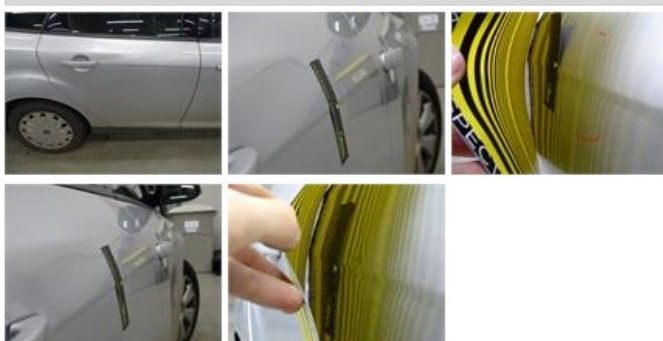


Wing R L, Dent(s), PDR - Paintless dent repair

63,00



Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80

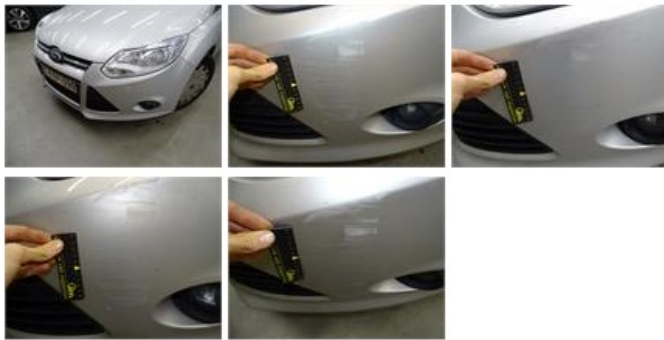

Door F L, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Wheel cover F R, Not original part, E - Replace 30,00



Rocker panel inner R R, Dent(s), LI - Repair and paint (complete) 115,56



Roof, Bad repair, Acceptable 0,00



Trunk lid covering R, Scratch(es), Acceptable 0,00

No pictures to display

Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Scratch(es), LI - Repair and paint (complete) 308,20





Wing F R, Scratch(es), Acceptable 0,00

No pictures to display

Rocker panel inner F L, Dent(s), LI - Repair and paint (complete) 115,56

