



SEAT ALHAMBRA: 1PPA427

Vinnumber:	VSSZZZ7NZHV702799	Versionname:	2.0 TDI 110kW Ecomotive Style
First Registrationdate:	18/08/2016	Fiscalpower:	
Expertise Mileage:	140679	Power Kw:	110
Bodytype:		Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3726
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	SD	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	215/60/16/95 H LightMetal			
Summer tyres:	Fr.L.	Continental: 4 mm	Fr.R.	Continental: 4 mm
	Re.L.	Continental: 5 mm	Re.R.	Continental: 5 mm

Assistance equipment

Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Total cost ex VAT	1009,27
Wing F L, Scratch(es), Acceptable	0,00
No pictures to display	
Tailgate, Chemical pollution, 67 - Polish	0,00
No pictures to display	
Door F L, Scratch(es), LI - Repair and paint (complete)	382,02



Door R R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 254,16




Wing R R, Chemical polution, 67 - Polish 0,00

No pictures to display

Reversible boot mat, Stain, Cleaning 25,00



Bonnet, Scratch(es), LI - Repair and paint (complete) 348,09

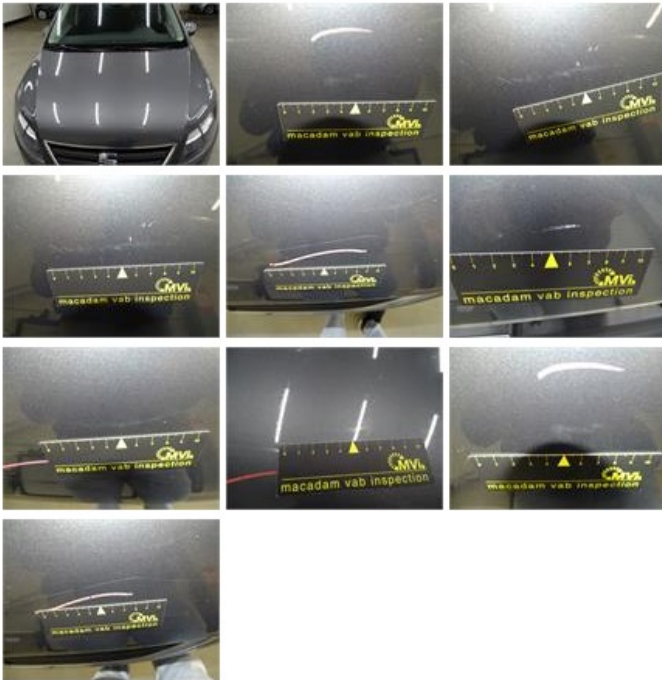

Rear window, Scratch(es), Acceptable 0,00



Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Luggage space cover, Damaged, Acceptable 0,00



Wing F R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Rearview mirror housing L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wing R L, Chemical polution, 67 - Polish	0,00
<i>No pictures to display</i>	