



BMW 3 GRAN TURISMO: 1LCE772

Vinnumber:	WBA8Y51080GJ87984	Versionname:	2.0 318D (100KW) GRAN TURISMO
First Registrationdate:	18/08/2015	Fiscalpower:	
Expertise Mileage:	116920	Power Kw:	100
Bodytype:		Body color:	White
Gearbox:	MAN 6 VIT	Paint type:	Opaque
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4202
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Rear parking sensors	
Windows electric F		Type of Tow bar	Tow bar removable
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		
Sport seats			

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/50/18/95 W LightMetal				
Summer tyres:	Fr.L.	Continental: 5 mm	Fr.R.	Continental: 5 mm
	Re.L.	Continental: 4 mm	Re.R.	Continental: 4 mm

Assistance equipment

Number of charging cables (normal)	0	Runflat	Yes
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1133,50
Door R L, Scratch(es), LI - Repair and paint (complete)	318,35




Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete)

95,00



Windscreen, Scratch(es), E - Replace

0,00

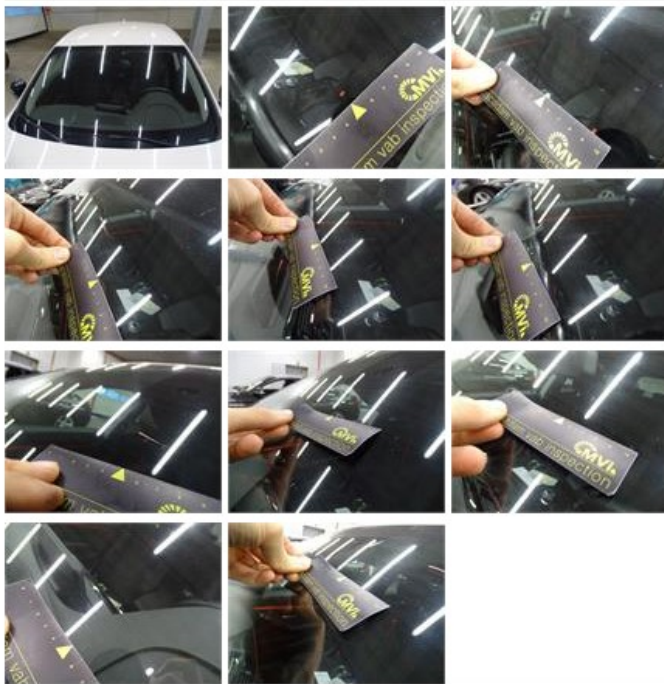

Reflector, Broken, E - Replace

0,00



Wing R R, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete)

95,00



Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete)

95,00



Alloy rim F L polished, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Deformed / Strained, Le - Replace and paint 0,00



Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80



Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Wing R L, Dent(s), It - Spot repair 0,00



Door F R, Dent(s), Acceptable 0,00

No pictures to display