



BMW 3: 1HAA078

| | | | |
|------------------------------------|--------------------------|--------------|------------------|
| Vinnumber: | WBA3Y110X0D450075 | Versionname: | |
| First Registrationdate: | 2/06/2014 | Fiscalpower: | |
| Expertise Mileage: | 193704 | Power Kw: | 100 |
| Bodytype: | | Body color: | Black |
| Gearbox: | MAN 6 VIT | Paint type: | Metalic |
| Transmission: | | Rims summer: | Aluminium |
| Fueltype: | Diesel | Oil level: | OK |
| Battery functioning: | Yes | Parking lot: | 2119 |
| Number of doors: | 5 | | |
| Number of seats: | 5 | | |
| Number head rests: | 5 | | |
| Rims summer: | Aluminium | | |
| Category: | Passenger Car | | |
| Oil level: | OK | | |
| Registration Certificate Car (BE): | Yes | | |

Options

| | |
|--------------------------------|------------------------------|
| Radio CD | Central consol F |
| Windows electric F | Front parking sensors |
| Windows electric R | Rear parking sensors |
| Cruise Control | Type of Tow bar |
| Steering wheel multifunctional | No Tow bar |
| Seats F heated | |
| Radio multimedia | |
| Type of headlighting | Headlighting Halogen |
| Type of GPS | GPS big screen color |
| Type of Lining | Lining leather |
| Type of climate control | Autom climate control |

Limited Technical Inspection

| | | | |
|---------------------|-----------|---------------------|------------|
| Airco functioning | OK | Battery functioning | Yes |
| Tires wear profile | OK | Power steering | Yes |
| Idle position | OK | Sound engine | OK |
| Engine startingtime | OK | Clutch test | OK |
| Exhaust gass | OK | Wiper fluid level | OK |
| Handbrake | OK | Transmission | OK |
| | | Lighting | OK |
| | | Wiperblades | OK |

Degree of wear

| | | | | |
|----------------------------------|-------|-----------------------|-------|-----------------------|
| 225/55/17/97 Y LightMetal | | | | |
| Summer tyres: | Fr.L. | Pirelli: 5 mm | Fr.R. | Pirelli: 5 mm |
| | Re.L. | Michelin: 7 mm | Re.R. | Michelin: 7 mm |

Assistance equipment

| | | | |
|---|------------|------------|----------------|
| Repair kit | Yes | Compressor | Yes |
| Total cost ex VAT | | | 1722,56 |
| Door F L, Dent(s), Acceptable | | | 0,00 |
| <i>No pictures to display</i> | | | |
| Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete) | | | 211,80 |



Wing F L, Scratch(es), Acceptable 0,00

No pictures to display

Rearlight R , Broken, E - Replace 114,00



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20




Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Sill outer R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00

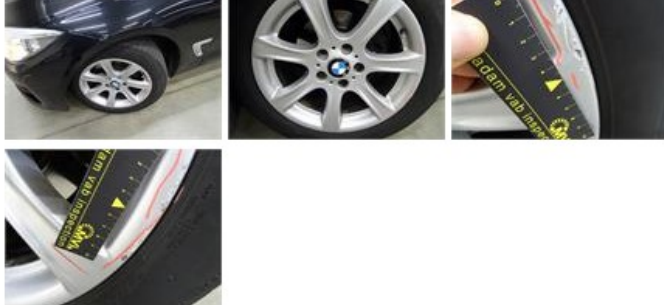

Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Bonnet, Scratch(es), LI - Repair and paint (complete) 290,08



Door R R, Scratch(es), 67 - Polish 0,00

No pictures to display

Tailgate, Dent(s), LI - Repair and paint (complete) 301,68



Alloy rim F R, Scratch(es), Acceptable 0,00

No pictures to display