


BMW 3 TOURING: AX9214

Vinnumber:	WBA8H91070K868626	Versionname:	2.0 320D (140KW) TOURING
First Registrationdate:	23/09/2016	Fiscalpower:	
Expertise Mileage:	93872	Power Kw:	140
Bodytype:	Break	Body color:	Dark Blue
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3505
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD		Seats electric F L	
GPS storage		Seats electric F R	
GPS storage	HD	Central consol F	
Windows electric F		Luggage cover	
Windows electric R		Rear parking sensors	
Steering wheel multifunctional		Type of Tow bar	Tow bar fixed
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/60/16/92 V LightMetal			
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Continental: 4 mm	Re.R.	Continental: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2214,08
-------------------	---------

Alloy rim F L, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Door F L, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display


Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)	318,35
---	--------



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



Roof, Chemical pollution, LI - Repair and paint (complete) 481,50

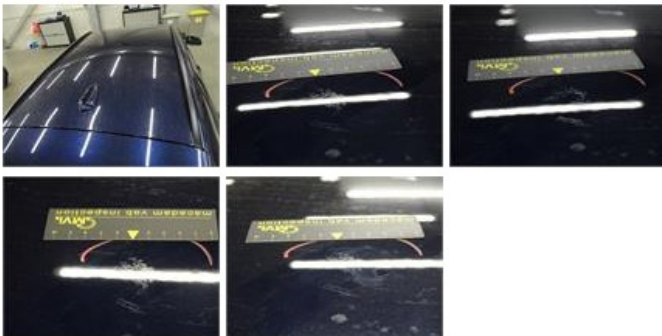

Protection plate M, Deformed / Strained, E - Replace 74,00



Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete) 211,80



Bonnet, Scratch(es), LI - Repair and paint (complete) 290,80





Alloy rim F R, Scratch(es), Acceptable 0,00

No pictures to display

Tailgate, Scratch(es), Acceptable 0,00

No pictures to display

Rear window, Scratch(es), Acceptable 0,00



Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80

