



## IVECO Daily 40C15: 1CFT028

Vinnumber:	ZCFC40A5005894109	Versionname:	DAILY PU2C 40C15 146PK 3500KG
First Registrationdate:	15/11/2011	Fiscalpower:	
Expertise Mileage:	241795	Power Kw:	107
Bodytype:	Transporter	Body color:	White
Gearbox:	MAN 6 VIT	Paint type:	Opaque
Transmission:	Back	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	LCV05
Number of doors:	4		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Steel		
Category:	Light Commercial Vehicle		
Oil level:	OK		

## Options

Radio CD	Central consol F	
Windows electric F	Type of Tow bar	Tow bar fixed
Cruise Control		
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	No GPS	
Type of Lining	Lining fabrics	
Type of climate control	No climate control	

## Limited Technical Inspection

Tires wear profile	OK	Battery functioning	Yes
Idle position	OK	Power steering	Yes
Engine startingtime	OK	Sound engine	OK
Exhaust gass	OK	Clutch test	OK
Handbrake	OK	Wiper fluid level	OK
		Transmission	OK
		Lighting	OK
		Wiperblades	OK

## Degree of wear

<b>195/75/16/105 R Steel</b>				
Summer tyres:	Fr.L.	Bridgestone: 5 mm	Fr.R.	Bridgestone: 5 mm
	Re.L.	Bridgestone: 6 mm	Re.R.	Bridgestone: 6 mm

## Assistance equipment

Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Total cost ex VAT	1721,60
Roof, Dent(s), Acceptable	0,00
<i>No pictures to display</i>	
Door F R, Dent(s) and scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Console storage compartment, Not functioning (well), E - Replace	64,00



Windscreen, Stone chip(s), Acceptable

0,00



Wing R L, Dent(s) and scratch(es), Forfeit

100,00



Wing R R, Dent(s) and scratch(es), Forfeit

100,00



Mirror side blinker L, Broken, E - Replace

28,50



Rear floor , Crack, Repair/replace (lump sum)

118,00



Sill outer L, Dent(s) and scratch(es), LI - Repair and paint (complete)

232,88



Dashboard, Hole, Smart repair


110,64



Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Tailgate, Dent(s) and scratch(es), Forfeit 100,00

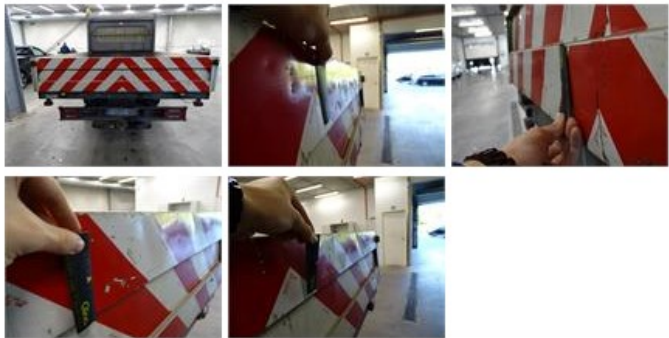

Ignition key, Missing, E - Replace 150,00

No pictures to display

Bumper F, Scratch(es), Acceptable 0,00

No pictures to display

Rearview mirror R complete, Scratch(es), Acceptable 0,00

No pictures to display

Floor covering F L, Hole, Smart repair 64,32



Wing F R, Scratch(es), Acceptable 0,00

No pictures to display

Door seal F L, Deformed / Strained, E - Replace 46,50



Floor covering F R, Hole, Smart repair 64,32



Mirror side blinker R, Broken, E - Replace 28,50



Sill outer R, Scratch(es), LI - Repair and paint (complete) 232,88



Seat cover F L, Worn, Acceptable 0,00



Door R R, Scratch(es), Acceptable 0,00

*No pictures to display*

Door F L, Scratch(es), Acceptable 0,00

*No pictures to display*

Bonnet, Dent(s), LI - Repair and paint (complete) 217,56



Rearview mirror glass L, Broken, E - Replace 13,50



Interior, Dirty, Cleaning 50,00



Rearview mirror housing L, Scratch(es), Acceptable 0,00

*No pictures to display*