



FORD S-MAX: 1PJV730

Vinnumber:	WF0JXXWPCJGK55381	Versionname:	
First Registrationdate:	18/07/2016	Fiscalpower:	
Expertise Mileage:	82997	Power Kw:	132
Bodytype:	SUV	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1414
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Front parking sensors
Windows electric R	Rear parking sensors
Cruise Control	Type of Tow bar
Steering wheel multifunctional	Tow bar removable
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	NOT OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear


	235/55/17/103 W LightMetal			
Summer tyres:	Fr.L.	Bridgestone: 3 mm	Fr.R.	Bridgestone: 3 mm
	Re.L.	Bridgestone: 3 mm	Re.R.	Bridgestone: 3 mm

Assistance equipment

Total cost ex VAT	1771,04
Alloy rim F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Alloy rim F R, Scratch(es), LI - Repair and paint (complete)	95,00



Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete) 382,02

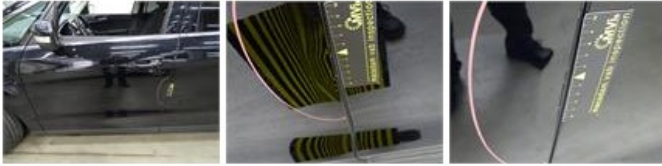


Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 369,84



Bumper R, Scratch(es), LI - Repair and paint (complete) 254,16



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 382,02

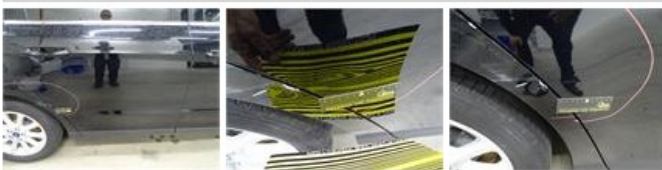

Luggage space cover, Missing, E - Replace 288,00

