



RENAULT MEGANE: 1TVC617

Vinnumber:	VF1BZ1A0749456920	Versionname:	
First Registrationdate:	19/07/2013	Fiscalpower:	
Expertise Mileage:	134804	Power Kw:	66
Bodytype:	Hatchback	Body color	Grey
Gearbox:	MAN 5 VIT	Paint type	Metalic
Transmission:		Rims summer	Steel
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	2325
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Steel		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Cruise Control	Type of Tow bar
Steering wheel multifunctional	No Tow bar
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Manual climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

	205/55/16/91 H Steel			
Winter tyres:	Fr.L.	Semperit: 4 mm	Fr.R.	Semperit: 4 mm
	Re.L.	Pirelli: 4 mm	Re.R.	Pirelli: 4 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
Total cost ex VAT			2845,15
Door R R, Chemical polution, LI - Repair and paint (complete)			318,35



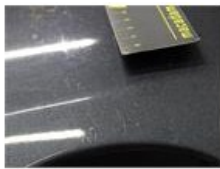

Bonnet, Hail damage, PDR - Hail

600,00



Rear spoiler, Dent(s), Acceptable

0,00

No pictures to display

Wheel cover F R, Scratch(es), Acceptable

0,00

No pictures to display

Bumper R, Scratch(es), Acceptable

0,00

No pictures to display

Wheel cover R R, Scratch(es), Acceptable

0,00

No pictures to display

Reflector, Broken, E - Replace

20,00



Door R R, Scratch(es), Acceptable

0,00

No pictures to display

Ignition key, Missing, E - Replace

150,00



Roof, Hail damage, PDR - Hail

1450,00



Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Rear spoiler, Chemical polution, 67 - Polish	0,00
No pictures to display	
Wing R R, Dent(s) and scratch(es), Acceptable	0,00
No pictures to display	
Wing F L, Scratch(es), LI - Repair and paint (complete)	95,00

