



OPEL ASTRA SPORTS TOURER: 1LHG585

Vinnumber:	W0LPD8E66G8008743	Versionname:	1.6 CDTI 81KW ECOFLEX S/S ULTIMATE EDITI
First Registrationdate:	29/09/2015	Fiscalpower:	
Expertise Mileage:	152942	Power Kw:	81
Bodytype:		Body color	White
Gearbox:	MAN 6 VIT	Paint type	Opaque
Transmission:	Front	Rims summer	Steel
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	3124
Number of doors	5		
Number of seats	5		
Number head rests	4		
Rims summer	Steel		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

GPS storage		Luggage cover	
GPS storage	HD	Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining semi-artificial leather		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	215/60/16/95 V Steel			
Summer tyres:	Fr.L.	Continental: 2 mm	Fr.R.	Continental: 2 mm
	Re.L.	Continental: 4 mm	Re.R.	Continental: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1414,86
Tailgate, Dent(s) and scratch(es), Acceptable	0,00
No pictures to display	
Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete)	318,35



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Wing R R, Repaired, Acceptable

0,00

No pictures to display

Rear window, Scratch(es), Acceptable

0,00



Bumper R, Broken, Le - Replace and paint

0,00



Wing R L, Scratch(es), LI - Repair and paint (complete)

308,20




Sill outer R, Dent(s), Acceptable

0,00

No pictures to display

Bonnet, Dent(s) and scratch(es), LI - Repair and paint (complete)

290,08

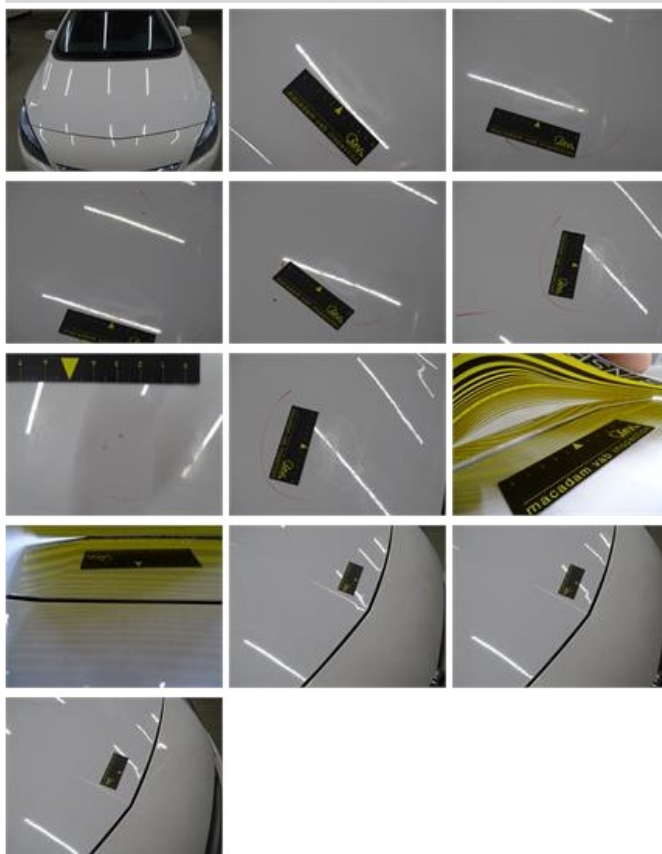

Bumper F, Scratch(es), Acceptable 0,00

No pictures to display

Seat cover F L, Worn, Acceptable 0,00



Floor covering F L, Hole, Smart repair 64,32



Wing F L, Scratch(es), Acceptable 0,00

No pictures to display

Rocker panel inner F L, Dent(s), LI - Repair and paint (complete) 115,56



Roof, Scratch(es), Acceptable 0,00

No pictures to display

Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Rearview mirror housing L, Scratch(es), Acceptable 0,00

No pictures to display