



SEAT LEON ST: 1RJG082

Vinnumber:	VSSZZZ5FZGR248383	Versionname:	1.6 TDI 81KW STYLE
First Registrationdate:	4/01/2017	Fiscalpower:	
Expertise Mileage:	175410	Power Kw:	81
Bodytype:		Body color	Silver
Gearbox:	MAN 5 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	3230
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD		Central consol F	
GPS storage	SD	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting LED		
Type of GPS	GPS big screen color		
Type of Lining	Lining semi-Alcantara		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

Summer tyres:	225/45/17/91 Y LightMetal			
	Fr.L.	Uniroyal: 4 mm	Fr.R.	Uniroyal: 4 mm
	Re.L.	Uniroyal: 5 mm	Re.R.	Uniroyal: 5 mm

Assistance equipment


Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1924,60
Bonnet, Dent(s), PDR - Paintless dent repair	122,40



Roof, Chemical polution, LI - Repair and paint (complete)

481,50

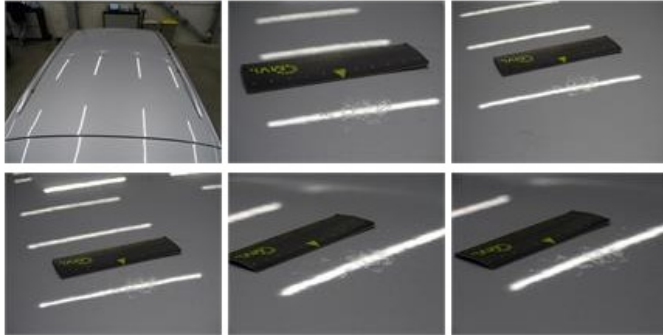

Bumper R, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00



Bumper F, Scratch(es), Acceptable

0,00

No pictures to display

Door F L, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00



Wing F R, Chemical polution, 67 - Polish

0,00

No pictures to display

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20





Door R R, Scratch(es), Acceptable 0,00

No pictures to display


Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Tailgate, Dent(s), LI - Repair and paint (complete) 301,68

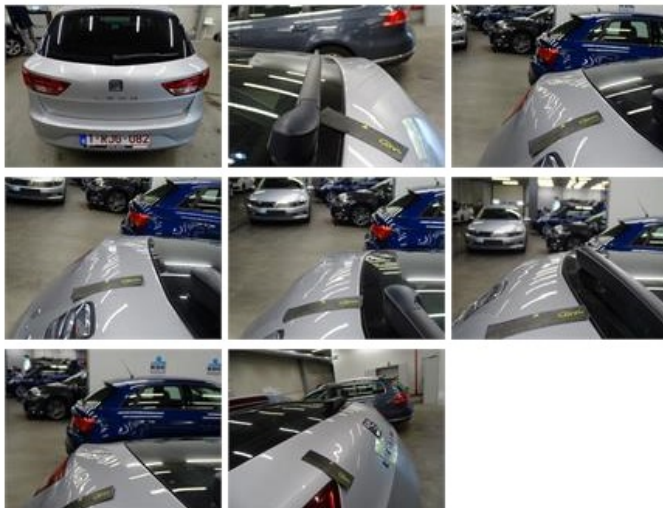

Seat cover F L, Worn, Acceptable 0,00




Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Wing F L, Dent(s) and scratch(es), LI - Repair and paint (complete) 220,18

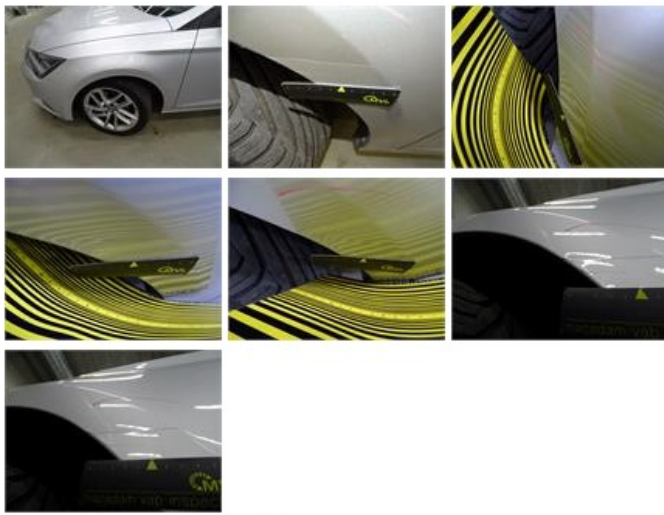

Door panel R L, Tear, Smart repair

110,64

