



BMW 3 GRAN TURISMO: 1KSJ424

Vinnumber:	WBA3Y11040GD87878	Versionname:	2.0 318D (100KW) GRAN TURISMO
First Registrationdate:	23/06/2015	Fiscalpower:	
Expertise Mileage:	100690	Power Kw:	100
Bodytype:		Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4606
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining artificial leather

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/55/17/97 Y LightMetal				
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Total cost ex VAT			1695,90
Roof, Scratch(es), 67 - Polish			25,00





Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00




Rearview mirror basis R, Scratch(es), Smart repair

110,64




Bonnet, Chemical polution, 67 - Polish

50,00

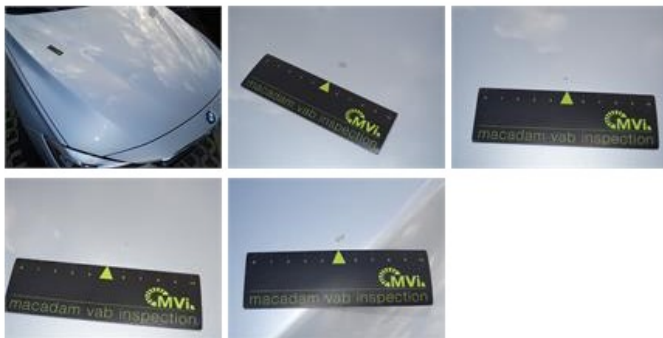

Boot carpet, Stain, Cleaning

0,00

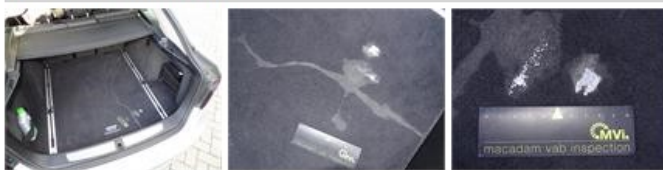

Alloy rim R L, Scratch(es), Acceptable

0,00



Bumper F, Scratch(es), It - Spot repair

115,56



Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

366,35



Wing R R, Scratch(es), LI - Repair and paint (complete)

308,20



Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Alloy rim F R, Scratch(es), Acceptable

0,00



Door R R, Scratch(es), LI - Repair and paint (complete)

318,35

