


NISSAN QASHQAI: 1KXC483

Vinnumber:	SJNFAAJ11U1373475	Versionname:	1.5 DCI CONNECT EDITION
First Registrationdate:	22/07/2015	Fiscalpower:	
Expertise Mileage:	214672	Power Kw:	81
Bodytype:		Body color	Black
Gearbox:	MAN 6 VIT	Paint type	Metallic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	3328
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD		Panoramic roof	
GPS storage		Central consol F	
GPS storage	HD	Luggage cover	
Windows electric F		Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control		Type of Tow bar	Tow bar removable
Steering wheel multifunctional			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	215/55/18/99 H LightMetal			
Winter tyres:	Fr.L.	Michelin: 2 mm	Fr.R.	Michelin: 2 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Total cost ex VAT			1321,11
Tailgate, Scratch(es), Acceptable			0,00
<i>No pictures to display</i>			
Floor covering F L, Hole, E - Replace			252,00



Wing moulding F R, Scratch(es), E - Replace 14,40



Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Interior, Dirty, Cleaning 100,00



Rear spoiler, Scratch(es), 67 - Polish 0,00

No pictures to display

Ignition key, Missing, E - Replace 150,00



Alloy rim R L polished, Scratch(es), Acceptable 0,00


No pictures to display

Wing R R, Dent(s), Acceptable 0,00

No pictures to display

Bonnet, Hail damage, PDR - Hail 300,00



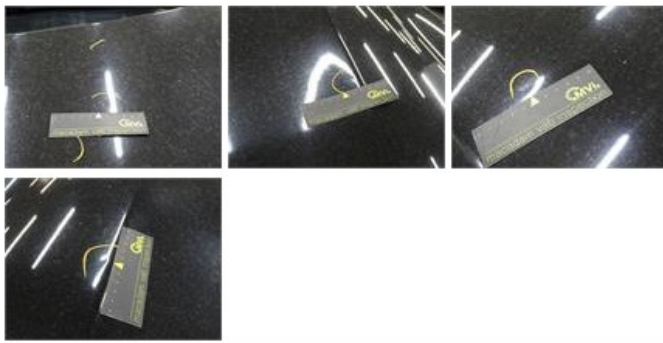

Rocker panel inner F R, Scratch(es), Acceptable	0,00
No pictures to display	
Wing R L, Scratch(es), Acceptable	0,00
No pictures to display	
Wing moulding F L, Scratch(es), E - Replace	14,40



Bumper F M, Scratch(es), Acceptable	0,00
No pictures to display	
Rocker panel inner R R, Scratch(es), Acceptable	0,00
No pictures to display	
Bumper moulding R, Scratch(es), E - Replace	14,40




Bumper F, Scratch(es), It - Spot repair	115,56
---	--------



Roof, Dent(s), Acceptable	0,00
No pictures to display	
Bumper spoiler F, Scratch(es), E - Replace	42,00



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)	318,35
---	--------

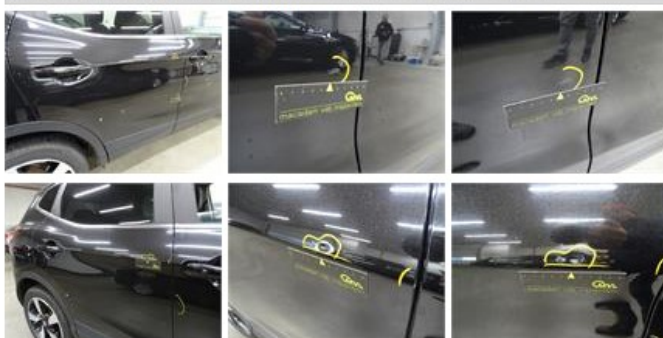



Door F R, Scratch(es), Acceptable	0,00
No pictures to display	
Wing F R, Scratch(es), Acceptable	0,00
No pictures to display	
Door R L, Scratch(es), Acceptable	0,00
No pictures to display	
Tailgate, Dent(s), Acceptable	0,00
No pictures to display	