



PEUGEOT 308: 1HPX033

Vinnumber:	VF3LBBHXHES177564	Versionname:	308 BER BlueHDi Allure STT 116PK
First Registrationdate:	9/09/2014	Fiscalpower:	
Expertise Mileage:	144395	Power Kw:	85
Bodytype:		Body color:	Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3731
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

GPS storage		Central consol F	
GPS storage	HD	Luggage cover	
Windows electric F		Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control		Type of Tow bar	No Tow bar
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting LED		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		
Level control			

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/55/16/91 V LightMetal				
Summer tyres:	Fr.L.	Continental: 2 mm	Fr.R.	Continental: 2 mm
	Re.L.	Continental: 5 mm	Re.R.	Continental: 5 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Total cost ex VAT	873,91
-------------------	--------

Alloy rim R L polished, Rust, Acceptable	0,00
--	------

No pictures to display

Door F L, Dent(s) and scratch(es), Acceptable	0,00
---	------

No pictures to display

Floor covering F L, Burned, Smart repair	64,32
--	-------



Rocker panel inner F R, Scratch(es), Acceptable 0,00

No pictures to display

Rocker panel inner R L, Scratch(es), Acceptable 0,00

No pictures to display

Sill F L, Deformed / Strained, E - Replace 74,24



Bodywork, Not original part, Sticker removal small 0,00

No pictures to display

Rearview mirror L complete, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Windscreen, Stone chip(s), Acceptable 0,00

No pictures to display

Rocker panel inner R R, Scratch(es), Acceptable 0,00

No pictures to display

Tailgate, Dent(s), Acceptable 0,00

No pictures to display

Door R R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete) 283,80



Trunk lid covering R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R R polished, Rust, Acceptable 0,00


No pictures to display

Alloy rim F R polished, Rust, Acceptable 0,00

No pictures to display

Interior, Dirty, Cleaning 48,00



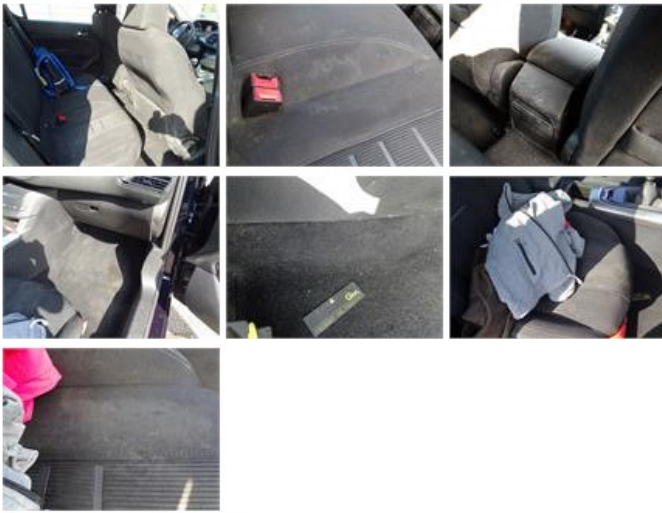

Wing R R, Dent(s), Acceptable 0,00

No pictures to display

Bonnet, Stone chip(s), Acceptable 0,00

No pictures to display

Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80



Door R L, Dent(s), Acceptable 0,00

No pictures to display

Trunk lid covering R, Broken, E - Replace 96,75



Door F R, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display