



PEUGEOT Partner: 1APU456

Vinnumber:	VF37A9HTCBJ513545	Versionname:	PARTNER B/F L1H1 P.CD-Airco 120 75PK
First Registrationdate:	1/03/2011	Fiscalpower:	
Expertise Mileage:	53835	Power Kw:	55
Bodytype:	Transporter	Body color:	White
Gearbox:	MAN 5 VIT	Paint type:	Opaque
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1723
Number of doors:	5		
Number of seats:	2		
Number head rests:	2		
Rims summer:	Steel		
Category:	Light Commercial Vehicle		
Oil level:	OK		

Options

Radio CD		Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	No GPS		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	NOT OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

195/65/15/91 H Steel				
Summer tyres:	Fr.L.	Fulda: 6 mm	Fr.R.	Fulda: 6 mm
	Re.L.	Fulda: 5 mm	Re.R.	Fulda: 5 mm

Assistance equipment

Spare wheel	Yes
Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Total cost ex VAT	2846,76
Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)	238,76





Trunk door R L, Dent(s) and scratch(es), It - Spot repair

115,56



Steering wheel, Worn, Acceptable

0,00

No pictures to display

Door frame F R, Dent(s), It - Spot repair

115,56



Rocker panel inner F R, Dent(s), LI - Repair and paint (complete)

115,56



Bodywork, Glue residues, Acceptable

0,00

No pictures to display

Wing R R, Scratch(es), Acceptable

0,00

No pictures to display

Bumper F, Broken, E - Replace

398,40



Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Trunk door R R, Scratch(es), It - Spot repair 115,56



Wing F L, Dent(s) and scratch(es), LI - Repair and paint (complete) 189,13



Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 165,13



Bumper grille, Broken, E - Replace 30,30



Door R R, Scratch(es), Acceptable 0,00

No pictures to display

Rearlight R - Broken - E - Replace 91,50



Rocker panel inner F L, Dent(s), LI - Repair and paint (complete)

115,56



Door frame F L, Dent(s), It - Spot repair

115,56



Ignition key, Broken, E - Replace

150,00



Bumper R, Scratch(es), Smart repair

110,64



Dashboard, Scratch(es), Acceptable


0,00



Roof, Dent(s), LI - Repair and paint (complete)

505,13



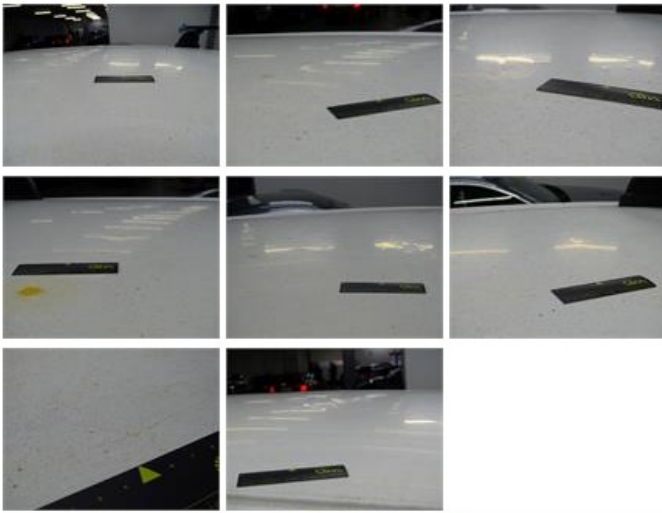

Bumper F, Scratch(es), LI - Repair and paint (complete) 158,85



Rearview mirror housing R, Scratch(es), Acceptable 0,00

No pictures to display

Sill outer R, Dent(s) and scratch(es), It - Spot repair 115,56



Wing R L, Scratch(es), Acceptable 0,00

No pictures to display