



**BMW 2 GRAN TOURER: 1LJX677**

Vinnumber:	<b>WBA2E110X0P930698</b>	Versionname:	<b>1.5 214D GRAN TOURER</b>
First Registrationdate:	<b>7/10/2015</b>	Fiscalpower:	
Expertise Mileage:	<b>126675</b>	Power Kw:	<b>70</b>
Bodytype:		Body color:	<b>Red</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Maintenance:	<b>OVER 21000 KM</b>	Parking lot:	<b>1404</b>
Maintenance:	<b>OK</b>		
Battery functioning:	<b>Yes</b>		
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

GPS storage		Central consol F
GPS storage	<b>HD</b>	Luggage cover
Windows electric F		Rear parking sensors
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Radio multimedia		
Type of headlighting	<b>Headlighting Halogen</b>	
Type of GPS	<b>GPS big screen color</b>	
Type of Lining	<b>Lining fabrics</b>	
Type of climate control	<b>Autom climate control</b>	

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

<b>205/60/16/92 V LightMetal</b>				
Summer tyres:	Fr.L.	<b>Vredestein: 7 mm</b>	Fr.R.	<b>Vredestein: 7 mm</b>
	Re.L.	<b>Michelin: 6 mm</b>	Re.R.	<b>Michelin: 6 mm</b>

**Assistance equipment**

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		

Total cost ex VAT	1144,95
Bumper F, Scratch(es), LI - Repair and paint (complete)	211,80



Door F L, Dent(s), LI - Repair and paint (complete) 318,35



Bonnet, Dent(s), PDR - Paintless dent repair 63,00




Ignition key, Missing, E - Replace 0,00



Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim R R, Scratch(es), I - Repair 100,00

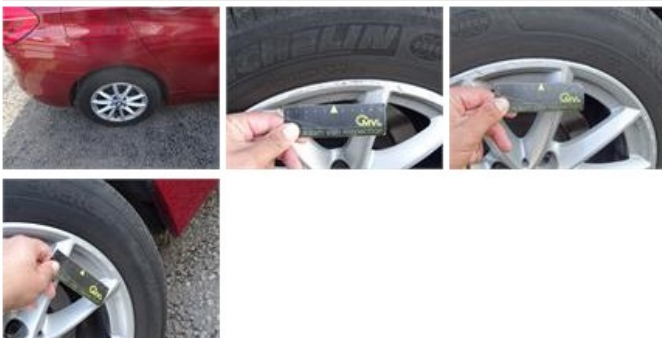

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Seat cover F L, Dirty, Cleaning 25,00



Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00



Seat cover F R, Stain, Cleaning

25,00

