



MERCEDES C COUP?: ZM8134

Vinnumber:	WDD2053401F659473	Versionname:	C 180
First Registrationdate:	21/10/2017	Fiscalpower:	
Expertise Mileage:	35091	Power Kw:	115
Bodytype:		Body color:	Grey
Gearbox:	Automatic	Paint type:	Metallic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Petrol	Oil level:	OK
Maintenance:	B1 DANS 194 JOURS	Parking lot:	3315
Maintenance:	OK		
Battery functioning:	Yes		
Number of doors:	2		
Number of seats:	4		
Number head rests:	4		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Seats electric F L	
GPS storage		Seats electric F R	
GPS storage	SD	Central consol F	
Windows electric F		Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control		Type of Tow bar	No Tow bar
Steering wheel multifunctional			
Alarm			
Radio multimedia			
Type of headlighting	Headlighting LED		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		
Level control			

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/45/18/95 V LightMetal				
Winter tyres:	Fr.L.	Michelin: 7 mm	Fr.R.	Michelin: 7 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Total cost ex VAT			1175,73
Bonnet, Stone chip(s), Acceptable			0,00

Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete)

95,00



Side window trim F R, Dent(s) and scratch(es), E - Replace

70,73



Door F L, Dent(s), Acceptable

0,00

No pictures to display

Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete)

95,00




Windscreen, Stone chip(s), Windscreen repair

88,20



Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80

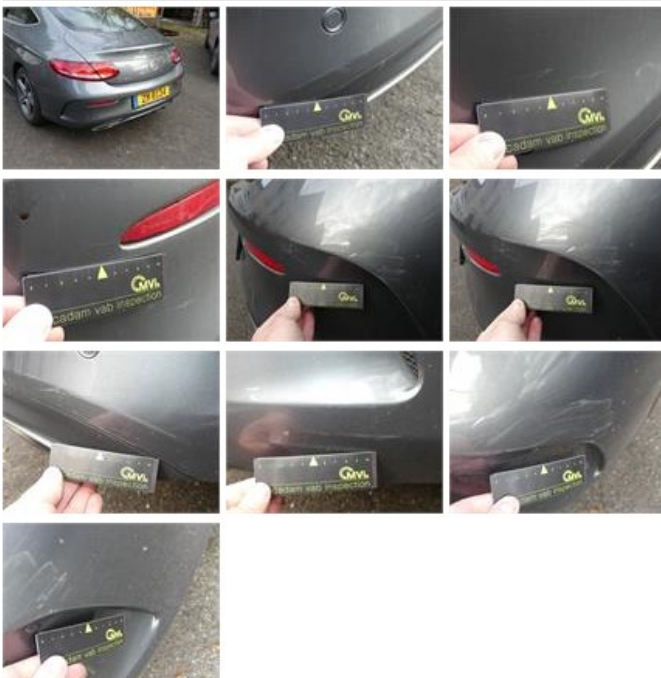

Outer door handle F L, Scratch(es), Acceptable

0,00

No pictures to display

Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete)

95,00



Wing R R, Scratch(es), LI - Repair and paint (complete)

308,20

