



PEUGEOT 2008: 1GKN410

Vinnumber:	VF3CU9HP8DY090354	Versionname:	2008 e-HDi Active BMP 92PK Aut.
First Registrationdate:	4/03/2014	Fiscalpower:	
Expertise Mileage:	112234	Power Kw:	68
Bodytype:		Body color:	Black
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Maintenance:	NOT OK	Parking lot:	1304
Maintenance:	UITVOEREN		
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

GPS storage	HD	Central consol F	
GPS storage		Luggage cover	
Windows electric F		Type of Tow bar	Tow bar fixed
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/55/16/91 V Steel				
Summer tyres:	Fr.L.	Uniroyal: 5 mm	Fr.R.	Uniroyal: 5 mm
	Re.L.	Uniroyal: 6 mm	Re.R.	Uniroyal: 6 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT 2677,94

Bumper F, Deformed / Strained, Le - Replace and paint 735,00



Luggage space cover, Missing, E - Replace 240,00



Mirror side blinker L, Broken, E - Replace 30,00



Door F R, Scratch(es), LI - Repair and paint (complete) 318,35



Wheel cover F R, Broken, E - Replace 30,00



Bumper moulding F M, Deformed / Strained, E - Replace 14,40



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Tailgate, Dent(s) and scratch(es), LI - Repair and paint (complete) 301,68



Maintenance, Maintenance, Execute 0,00



Seat cover F L, Stain, Cleaning 25,00



Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Door R L, Scratch(es), Acceptable 0,00

No pictures to display

No pictures to display

Door panel R L, Scratch(es), Smart repair 110,64




Wing R L, Scratch(es), Acceptable 0,00

No pictures to display


Seat cover R, Stain, Cleaning 25,00




Interior, Dirty, Cleaning 25,00

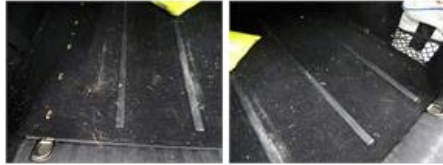


Seat cover F L, Hole, Smart repair 64,32

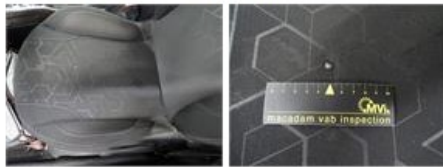

Ceiling, Stain, Cleaning 25,00

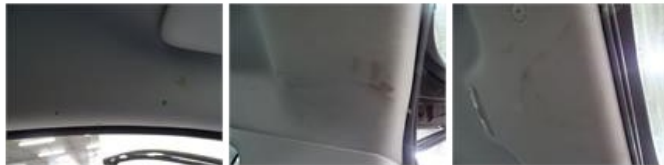

Bonnet, Chemical pollution, 67 - Polish 0,00

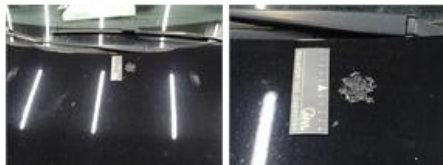

Bumper R, Deformed / Strained, E - Replace 415,20

