



MERCEDES C COUP?: ZM8166

Vinnumber:	WDD2053401F655603	Versionname:	C 180
First Registrationdate:	9/10/2017	Fiscalpower:	
Expertise Mileage:	30425	Power Kw:	115
Bodytype:		Body color:	Black
Gearbox:	Automatic	Paint type:	Metallic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Petrol	Oil level:	OK
Maintenance:	OK	Parking lot:	1714
Maintenance:	B1 DANS 105 JOURS		
Battery functioning:	Yes		
Number of doors:	2		
Number of seats:	4		
Number head rests:	4		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Seats electric F L	
GPS storage	SD	Seats electric F R	
GPS storage		Central consol F	
Windows electric F		Front parking sensors	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Type of Tow bar	No Tow bar
Alarm			
Radio multimedia			
Type of headlighting	Headlighting LED		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		
Level control			

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/45/18/95 V LightMetal				
Winter tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	2038,54
--------------------------	----------------

Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete)	412,18
--	---------------



Roof pillar L, Dent(s), Acceptable 0,00

No pictures to display

Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete) 307,80



Tyre F L, Tear, E - Replace 132,00



Wing F L, Scratch(es), Acceptable 0,00

No pictures to display

Tailgate, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Door F L, Scratch(es), Tu - Touch up 30,00



Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Roof, Dent(s), Acceptable 0,00

No pictures to display

Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Roof pillar R, Dent(s), Acceptable 0,00

No pictures to display


Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Sill trim L, Dent(s) and scratch(es), It - Spot repair 115,56



Wing R L, Dent(s), PDR - Paintless dent repair 63,00

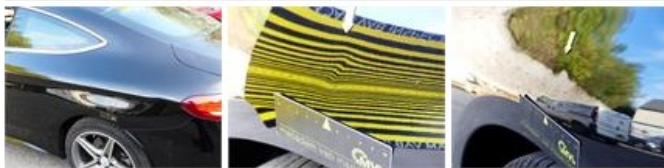

Bonnet, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Rearview mirror housing R, Scratch(es), Acceptable 0,00

rear view mirror housing (r), scratch(es), acceptable 0,00

No pictures to display

Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Certificate Of Conformity, Missing, P - Check 0,00



Door F R, Scratch(es), Tu - Touch up 30,00



Tires, Not original part, Acceptable 0,00

No pictures to display

Wing R L, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 356,20

