



## VOLKSWAGEN TOURAN: 1PYY169

Vinnumber:	WVGZZZ1TZW037066	Versionname:	2.0 TDI SCR 110KW DSG-6 HIGHLINE
First Registrationdate:	14/10/2016	Fiscalpower:	
Expertise Mileage:	181928	Power Kw:	110
Bodytype:		Body color:	Grey
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1732
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

## Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	SD	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining semi-Alcantara		
Type of climate control	Autom climate control		

## Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

## Degree of wear

	205/60/16/96 W LightMetal			
Summer tyres:	Fr.L.	Goodyear: 3 mm	Fr.R.	Goodyear: 3 mm
	Re.L.	Pirelli: 4 mm	Re.R.	Pirelli: 4 mm

## Assistance equipment

Repair kit	Yes	Compressor	No
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		


Total cost ex VAT	1382,12
Rear window, Scratch(es), Acceptable	0,00



A-pillar right, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Chemical polution, LI - Repair and paint (complete) 481,50

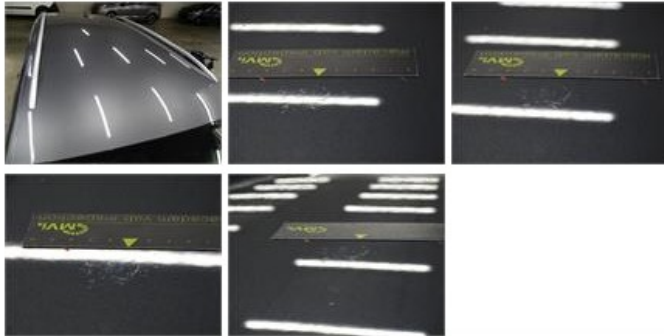

Wing F L, Chemical polution, LI - Repair and paint (complete) 220,18



Door F R, Dent(s), PDR - Paintless dent repair 63,00



Door R R, Scratch(es), Acceptable 0,00

No pictures to display

Tailgate, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Dent(s) and scratch(es), LI - Repair and paint (complete) 290,08



Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Backhoe rear inner B.L. Dent(s), LI - Repair and paint (complete) 445,50




Bumper F, Scratch(es), Acceptable

0,00

No pictures to display

Compressor, Missing, E - Replace

0,00

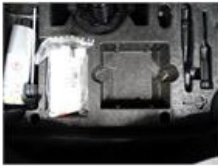

Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80

