



BMW 3: 1FXI184			
Vinnumber:	WBA3D11080J625405	Versionname:	3 BER 318d 143PK
First Registrationdate:	26/11/2013	Fiscalpower:	
Expertise Mileage:	141040	Power Kw:	105
Bodytype:		Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1406
Number of doors:	4		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options			
Radio CD		Central consol F	
GPS storage	HD	Type of Tow bar	No Tow bar
GPS storage			
Windows electric F			
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining artificial leather		
Type of climate control	Autom climate control		

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	225/50/17/94 W LightMetal			
Summer tyres:	Fr.L.	Pirelli: 6 mm	Fr.R.	Pirelli: 6 mm
	Re.L.	Goodyear: 4 mm	Re.R.	Goodyear: 4 mm

Assistance equipment			
Number of charging cables (normal)	0	Runflat	Yes
Number of charging cables (rapid charge)	0		

Total cost ex VAT	517,00
Door R R, Dent(s), PDR - Paintless dent repair	63,00




Door F R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door R L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wing F R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Bumper F, Dent(s) and scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Bumper R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Roof, Chemical polution, 67 - Polish	0,00
<i>No pictures to display</i>	
Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)	308,20



Tailgate, Dent(s), PDR - Paintless dent repair	63,00
--	-------



Bonnet, Dent(s), PDR - Paintless dent repair	82,80
--	-------

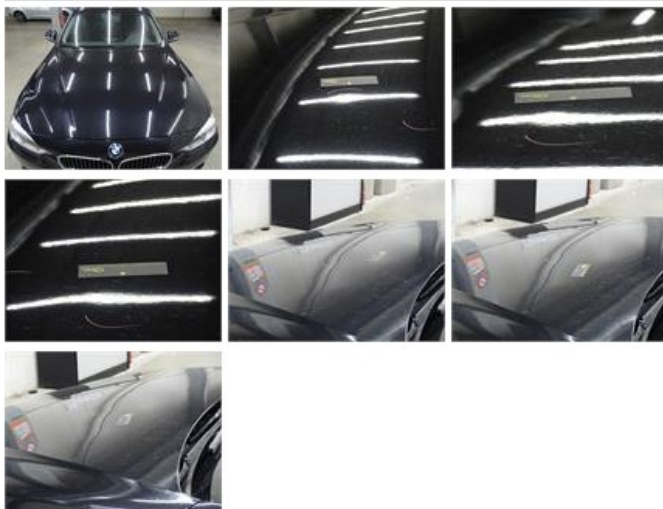

Alloy rim F R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Seat cover F L, Worn, Acceptable	0,00

