



OPEL COMBO: 1RCJ870

Vinnumber:	W0L6ZZU1AH9606245	Versionname:	1.3 CDTi 70KW 2.0T L1H1
First Registrationdate:	15/11/2016	Fiscalpower:	
Expertise Mileage:	38574	Power Kw:	70
Bodytype:		Body color	Black
Gearbox:	MAN 5 VIT	Paint type	Metallic
Transmission:	Front	Rims summer	Steel
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	1224
Number of doors	4		
Number of seats	2		
Number head rests	2		
Rims summer	Steel		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD	Type of Tow bar	No Tow bar
Windows electric F		
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	No GPS	
Type of Lining	Lining fabrics	
Type of climate control	Manual climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

Summer tyres:	185/65/15/92 T Steel			
	Fr.L.	Pirelli: 4 mm	Fr.R.	Pirelli: 4 mm
	Re.L.	Pirelli: 6 mm	Re.R.	Pirelli: 6 mm

Assistance equipment

Spare wheel	Yes
Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Total cost ex VAT	890,19
Roof, Chemical polution, 67 - Polish	0,00
No pictures to display	
Trunk door R R, Scratch(es), Acceptable	0,00
No pictures to display	
Bumper F, Not original part, Acceptable	0,00



Wing F L, Scratch(es), 67 - Polish 0,00

No pictures to display

Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete) 238,76



Trunk door R L, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 231,15




Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Wing F R, Deformed / Strained, LI - Repair and paint (complete) 189,13



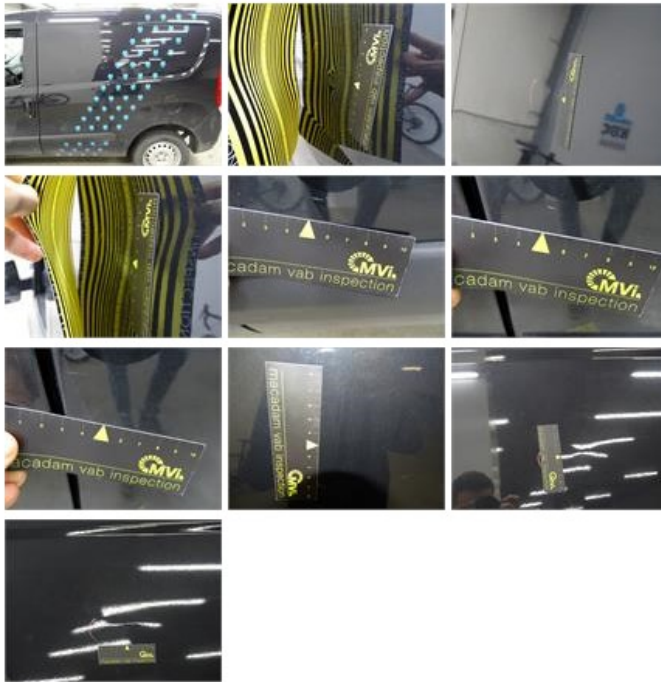

Door F R, Scratch(es), Acceptable

0,00

No pictures to display

Internal Boot Lining R, Scratch(es), Acceptable

0,00

No pictures to display

Bonnet, Chemical polution, 67 - Polish

0,00

No pictures to display