



FORD Focus: 1HUB006

Vinnumber:	WF0LXXGCBLEP54107	Versionname:	FOCUS CLIP.ECO Titanium 136PK
First Registrationdate:	2/10/2014	Fiscalpower:	
Expertise Mileage:	194441	Power Kw:	100
Bodytype:		Body color	Grey
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	3403
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD	Central consol F
GPS storage	Luggage cover
GPS storage	SD Rear parking sensors
Windows electric F	Type of Tow bar
Windows electric R	Tow bar fixed
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

Summer tyres:	215/55/16/97 W LightMetal			
	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Emergency spare wheel	Yes
Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Total cost ex VAT	1904,11
Centre console, Scratch(es), Smart repair	110,64



Wing F L, Scratch(es), Acceptable

0,00

No pictures to display

Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete)

211,80



Seat cover F L, Worn, Acceptable

0,00



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00



Rocker panel inner R R, Dent(s), LI - Repair and paint (complete)

115,56



Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00



Rocker panel inner R L, Dent(s), Acceptable 0,00

No pictures to display

Backrest cover F L, Hole, E - Replace 360,00



Roof pillar L, Bad repair, Acceptable 0,00




Door panel R R, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Rear window, Scratch(es), E - Replace 0,00

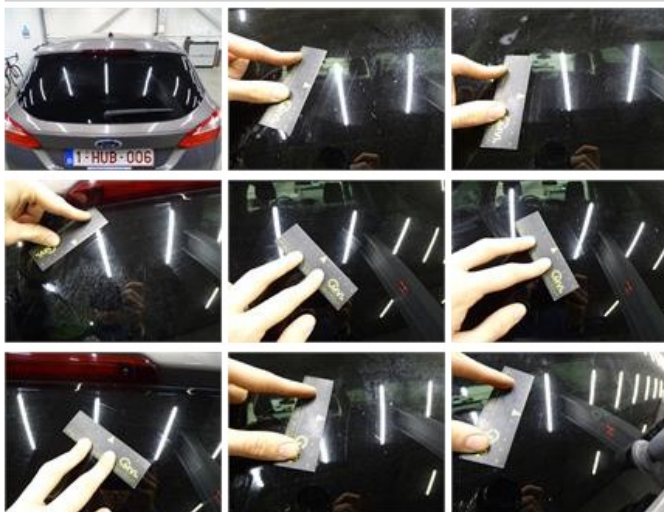

Mirror side blinker R, Crack, E - Replace 30,00



Door F L, Dent(s), LI - Repair and paint (complete) 342,35



Rocker panel inner F R, Dent(s), Acceptable 0,00

No pictures to display

Windscreen, Scratch(es), E - Replace 0,00



Bumper grille, Deformed / Strained, E - Replace

32,40



Trunk lid covering R, Scratch(es), Smart repair


110,64



Bumper R, Scratch(es), Smart repair

110,64

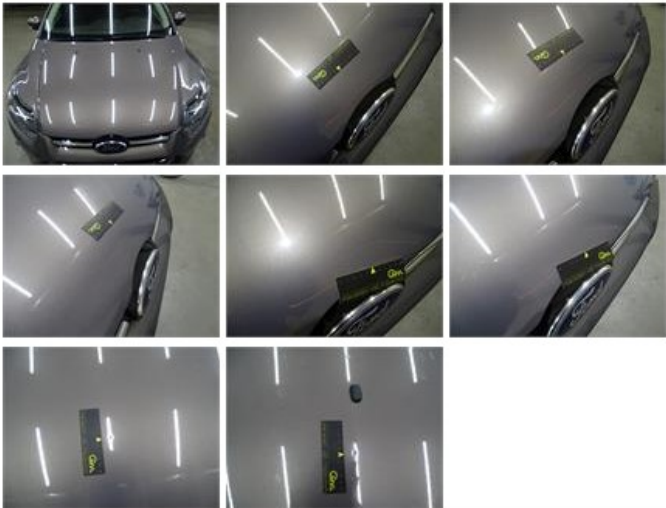

Door R R, Bad repair, Acceptable		0,00
		
Bonnet, Scratch(es), LI - Repair and paint (complete)		290,08
		
Tailgate, Scratch(es), Acceptable		0,00
No pictures to display		
Door R L, Dent(s) and scratch(es), Acceptable		0,00
No pictures to display		