



**BMW 1 HATCH: 1LHG591**

Vinnumber:	<b>WBA1S510X05A83837</b>	Versionname:	<b>2.0 118D (100KW)</b>
First Registrationdate:	<b>29/09/2015</b>	Fiscalpower:	
Expertise Mileage:	<b>98885</b>	Power Kw:	<b>100</b>
Bodytype:	<b>Hatchback</b>	Body color:	<b>Black</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Back</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Maintenance:	<b>UITVOEREN</b>	Parking lot:	<b>3330</b>
Maintenance:	<b>NOT OK</b>		
Battery functioning:	<b>Yes</b>		
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	<b>HD</b>	Rear parking sensors	
Windows electric F		Type of Tow bar	<b>No Tow bar</b>
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	<b>Headlighting Halogen</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining leather</b>		
Type of climate control	<b>Autom climate control</b>		

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>205/55/16/91 W LightMetal</b>			
Summer tyres:	Fr.L.	<b>Hankook: 4 mm</b>	Fr.R.	<b>Hankook: 4 mm</b>
	Re.L.	<b>Hankook: 4 mm</b>	Re.R.	<b>Hankook: 4 mm</b>

**Assistance equipment**

Repair kit	<b>No</b>	Compressor	<b>Yes</b>
------------	-----------	------------	------------

Total cost ex VAT 1860,75

Door F L, Dent(s), Acceptable 0,00

*No pictures to display*

Tyre repair kit, Missing, E - Replace 210,53



Maintenance, Maintenance, Execute 0,00



Bonnet, Dent(s) and scratch(es), LI - Repair and paint (complete) 290,08



Door R R, Repaired, Acceptable 0,00



Sill outer R, Dent(s) and scratch(es), LI - Repair and paint (complete) 310,50



Trunk lid covering R, Scratch(es), Smart repair 110,64



Wheel hub cap R R, Missing, E - Replace 10,00



Boot carpet, Stain, Cleaning 25,00



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00







Door R L, Repaired, Acceptable 0,00



Roof, Dent(s), PDR - Paintless dent repair 63,00




Wing F L, Repaired, No repair 0,00



Bumper R, Deformed / Strained, Le - Replace and paint 651,00



Rear window, Scratch(es), E - Replace 0,00

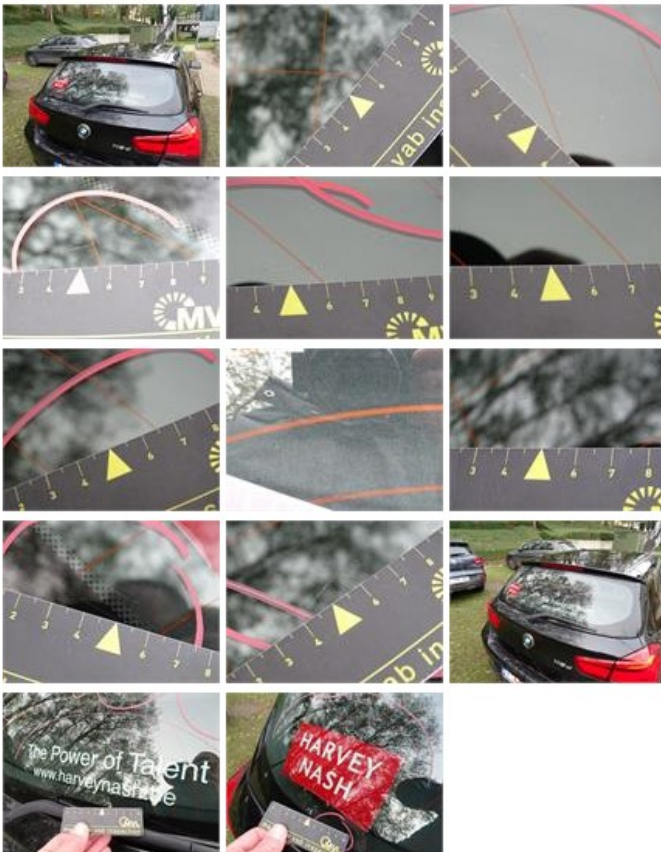

Bumper F, Repaired, No repair 0,00



Wing R L, Repaired, No repair	0,00
-------------------------------	------



Alloy rim R L, Scratch(es), Acceptable	0,00
--	------

*No pictures to display*

Alloy rim R R, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------

