



BMW 4 GRAN COUPE: 1LLG057

Vinnumber:	WBA4E710X0GR81436	Versionname:	2.0 418D (110KW) GRAN COUPE
First Registrationdate:	19/10/2015	Fiscalpower:	
Expertise Mileage:	116461	Power Kw:	110
Bodytype:		Body color:	Silver
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2728
Number of doors:	5		
Number of seats:	5		
Number head rests:	4		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	Tow bar fixed
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/50/17/94 W LightMetal				
Summer tyres:	Fr.L.	Bridgestone: 5 mm	Fr.R.	Bridgestone: 5 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1073,64
--------------------------	----------------

Door R L, Dent(s) and scratch(es), Acceptable	0,00
--	-------------

No pictures to display

Bumper R, Scratch(es), Acceptable	0,00
--	-------------



Tailgate, Scratch(es), Acceptable 0,00

No pictures to display

Wing F R, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 369,84




Bumper F, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Chemical pollution, LI - Repair and paint (complete) 577,80



Bonnet, Dent(s), PDR - Paintless dent repair 63,00

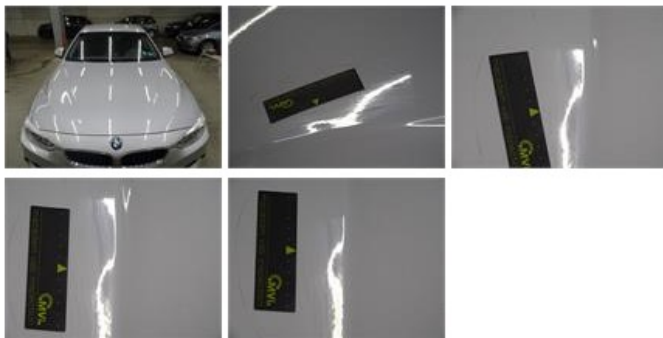

Wing F L, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Bad repair, Acceptable 0,00



Door F L, Dent(s), PDR - Paintless dent repair 63,00



