



BMW 3 REEKS: 1HTS127

Vinnumber:	WBA3K11050K285940	Versionname:	
First Registrationdate:	30/09/2014	Fiscalpower:	
Expertise Mileage:	333398	Power Kw:	105
Bodytype:		Body color:	Black
Gearbox:	Automatic	Paint type:	Metallic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1328
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Rear parking sensors	
GPS storage	HD	Type of Tow bar	No Tow bar
Windows electric F			
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	No
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/45/18/91 Y LightMetal				
Summer tyres:	Fr.L.	Pirelli: 5 mm	Fr.R.	Pirelli: 5 mm
	Re.L.	Pirelli: 3 mm	Re.R.	Pirelli: 3 mm

Assistance equipment

Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Total cost ex VAT	3154,52
Wing F R, Dent(s) and scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door panel R R, Tear, E - Replace	114,00



Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete)

95,00



Rear window, Scratch(es), E - Replace

370,00



Wing F L, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete)

95,00



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20




Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete)

95,00



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35

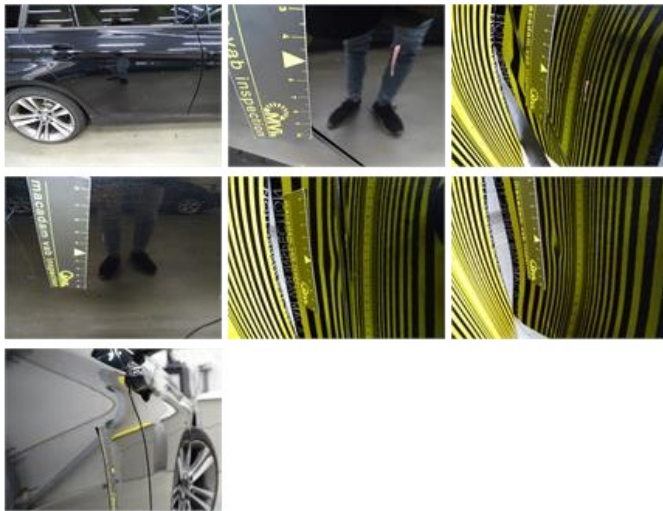

Door F R, Dent(s) and scratch(es), Acceptable

0,00

No pictures to display

Door R L, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete)

95,00



Bonnet, Scratch(es), 67 - Polish

0,00

No pictures to display

Door F L, Scratch(es), LI - Repair and paint (complete)

318,35



Rear spoiler, Dent(s) and scratch(es), Acceptable

0,00

No pictures to display

Luggage space cover, Missing, E - Replace

240,00



Bumper F, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete) 211,80



Windscreen, Stone chip(s), Acceptable 0,00



Trunk lid covering R, Scratch(es), Smart repair 110,64



Tailgate, Scratch(es), LI - Repair and paint (complete) 301,68



Roof, Dent(s) and scratches, LI - Repair and paint (complete) 481,50

