
KIA SPORTAGE: MD0817

Vinnumber:	U5YPH815GHL363765	Versionname:	Style Pack 1.7 CRDi 141 DCT 2WD ISG
First Registrationdate:	22/11/2017	Fiscalpower:	
Expertise Mileage:	81893	Power Kw:	104
Bodytype:		Body color:	Black
Gearbox:	Automatic	Paint type:	Metallic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3332
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

GPS storage		Seats R heated	
GPS storage	SD	Seats electric F L	
Windows electric F		Seats electric F R	
Windows electric R		Sun Roof electric	
Cruise Control		Panoramic roof	
Steering wheel multifunctional		Central consol F	
Seats F heated		Luggage cover	
Radio multimedia		Front parking sensors	
Type of headlighting	Headlighting Halogen	Rear parking sensors	
Type of GPS	GPS big screen color	Type of Tow bar	Tow bar removable
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	NOT OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

	245/45/19/98 W LightMetal			
Summer tyres:	Fr.L.	Hankook: 1 mm	Fr.R.	Hankook: 1 mm
	Re.L.	Hankook: 5 mm	Re.R.	Hankook: 5 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	704,51
Rear spoiler, Chemical polution, LI - Repair and paint (complete)	115,56

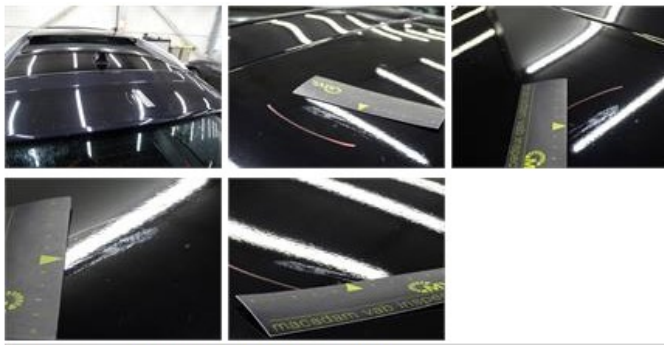

Windscreen, Stone chip(s), Windscreen repair 58,80



Wing F R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F L polished, Scratch(es), Acceptable 0,00

No pictures to display

Door F L, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Seat cover F R, Worn, Acceptable 0,00



Tailgate, Scratch(es), 67 - Polish 0,00

No pictures to display

Wing R L, Chemical polution, 67 - Polish 0,00

No pictures to display

Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R L polished, Scratch(es), Acceptable 0,00

No pictures to display

Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80





Bumper R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Bonnet, Chemical polution, 67 - Polish	0,00

No pictures to display