



MINI : 1PEN970			
Vinnumber:	WMWXN110X03B51818	Versionname:	1.5 ONE D
First Registrationdate:	17/06/2016	Fiscalpower:	
Expertise Mileage:	95709	Power Kw:	70
Bodytype:		Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metallic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2101
Number of doors:	3		
Number of seats:	4		
Number head rests:	4		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options			
GPS storage		Luggage cover	
GPS storage	HD	Type of Tow bar	No Tow bar
Windows electric F			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	175/65/15/84 H LightMetal			
Summer tyres:	Fr.L.	Uniroyal: 7 mm	Fr.R.	Uniroyal: 7 mm
	Re.L.	Hankook: 6 mm	Re.R.	Hankook: 6 mm

Assistance equipment			
Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2182,40
Rear window, Scratch(es), E - Replace	370,00





Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



Alloy rim F L, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Rearview mirror housing L, Scratch(es), Acceptable 0,00



Bumper F, Scratch(es), Acceptable 0,00

No pictures to display

Wheel hub cap F L, Not original part, Acceptable 0,00

No pictures to display

Bumper F M, Scratch(es), Smart repair 110,64



Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 220,18




Alloy rim R R, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Scratch(es), Acceptable 0,00

No pictures to display


Bonnet, Chemical pollution, LI - Repair and paint (complete) 290,08

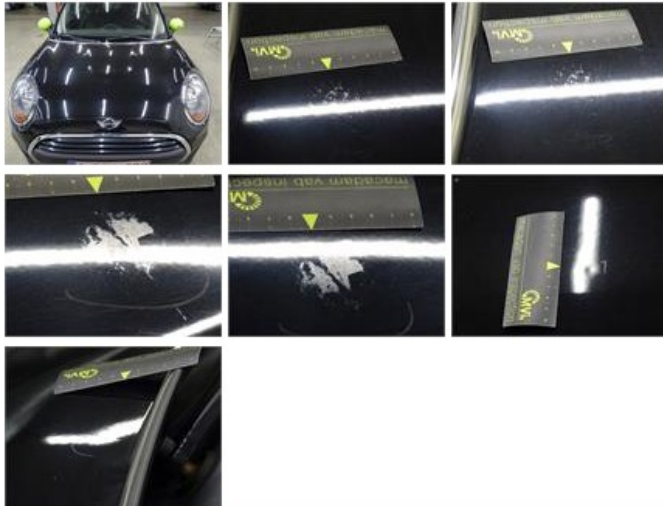

Rear spoiler, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Dent(s) and scratch(es), LI - Repair and paint (complete) 481,50

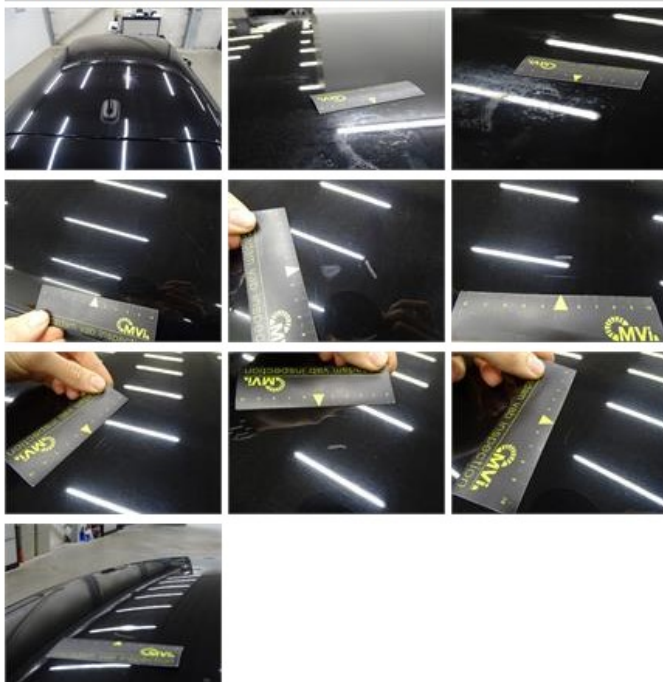

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Tailgate, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wing R L, Bad repair, Acceptable	0,00



Alloy rim R L, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------

