



FORD FOCUS CLIPPER: DY7856

Vinnumber:	WF06XXGCC6GY24449	Versionname:	1.5 TDCI 88KW S/S BUSINESS CLASS+
First Registrationdate:	16/11/2016	Fiscalpower:	
Expertise Mileage:	132018	Power Kw:	88
Bodytype:		Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4702
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD		Central consol F	
GPS storage	HD	Front parking sensors	
GPS storage		Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/55/16/91 V LightMetal				
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment

Repair kit	No	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	3615,98
Tyre repair kit, Missing, E - Replace	210,53



Door F R, Scratch(es), LI - Repair and paint (complete)

318,35




Tailgate, Dent(s) and scratch(es), LI - Repair and paint (complete)

301,68



Roof, Chemical pollution, LI - Repair and paint (complete)

481,50

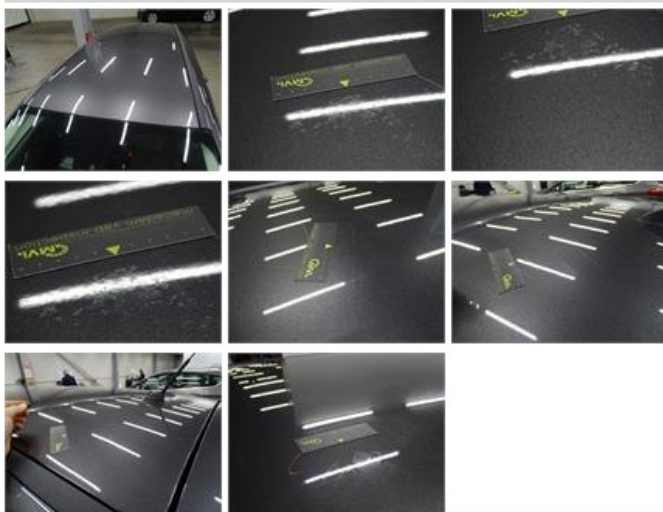

Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00



Door panel R R, Scratch(es), Acceptable

0,00

No pictures to display


Door panel R L, Scratch(es), Acceptable

0,00

No pictures to display

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20

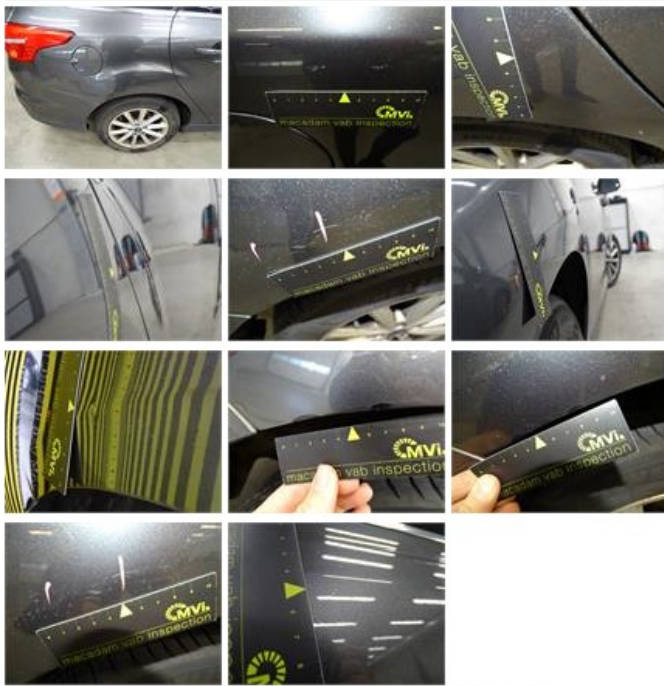

Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Bumper corner R L, Scratch(es), Acceptable

0,00

No pictures to display

Luggage space cover, Missing, E - Replace

240,00



Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

220,18



Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35





Trunk lid covering R, Scratch(es), Smart repair

110,64



Windscreen, Stone chip(s), Windscreen repair

58,80



Bonnet, Chemical pollution, 67 - Polish

0,00

No pictures to display

Wing F L, Scratch(es), Acceptable

0,00

No pictures to display

Bumper R, Scratch(es), Smart repair

110,64



Door R R, Bad repair, Acceptable

0,00



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20



Rear window, Scratch(es), Acceptable 0,00



Rear spoiler, Chemical pollution, LI - Repair and paint (complete) 115,56



Bumper F, Scratch(es), Acceptable 0,00

No pictures to display

Boot carpet, Tear, E - Replace 100,00



Alloy rim F L, Scratch(es), Acceptable 0,00

No pictures to display